

•	Report ID:	27,824,692	Version:	2
	Created:	05 Dec 2025		


	ОК	Requires Attention	N/A
Engine			
Oil level	~		
Smoke & fumes	1		
Engine performance	1		
Noise	1		
Coolant condition	/		
Cooling performance	1		
Radiator / Hoses (visual)	1		
Transmission		1	
Operation	1		
Noise	1		
Clutch			1
CV joints	1		
Wheel bearings	/		_
Brakes			
Performance	/		
Hand brake	1		
Tyres (lowest observed tread d	onth of	turos)	
Left front	еритог		4.0 mm
Right front			4.5 mm
Left rear			4.5 mm
Right rear	.,		5.5 mm
Spare	Yes		
Suspension		Ī	T
Suspension performance	/		
Steering performance	/		<u> </u>
Shock absorbers			
Air Conditioning / Heater			ı
Operation			
Electrical / Accessories	ı	1	
Head lights	~		<u> </u>
Tail lights	•		
Indicators	1		
Dashboard warning lights	/		
Wipers (front & rear)			
Window winder FL	•		
Window winder FR	1		
Window winder RL	1		
Window winder RR	1		
Rear view mirrors	1		
Radio (basic test only)		'	
CD (basic test only)		/	
Number of keys	1	•	
Central locking	1		
Remote locking	1		
Sat. nav. (basic test only)			·
Reversing camera	1		

Make:	Toyota	Model:	Corolla
Body Style:	Hatchback	Year:	2006
Rego No.:	GSD384	Rego Expiry:	04 Jul 2026
WoF Expiry:	16 Dec 2026	Odometer:	138,349 Kms
Good No.:	27824692	VIN:	7AT0H607X12407112
Next Service:	148,300kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

itcy				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

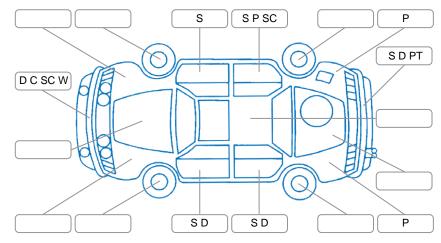

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Paint is flaking on rear bumper. Both door mirrors paint is flaking. Minor stone cracks in left side of windshield.

Conditions During Body Inspection	Dry	
Under Carriage and Under Bonnet Inspection Comments		

Interior Comments		
Seats:	Good	
Carpets:	Good	
Panels:	Good	
Dashboard:	Good	

General Comments

Head unit touch panel is faulty. Only playing existing CD(can not eject). Rear windows only controlled by rear seat controls

Road Conditions During Test Drive		Dry
Engine Timing Mechanism		Timing Chain
Evidence of Cam Belt Replacement		Yes No Kms
Inspected by:	Yuki Itohara	
Published by:	Nick Beaton	
Inspection Date:	02 Dec 2025	

П	nave	read	and	unde	rstood
tł	nis co	nditi	on a	uide	

NAME			