


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Isuzu | Model: | Bighorn | Body Style: | Wagon |
| Year: | 1,993 | Registration: | ALL416 | Reg Expiry: | 22 Jun 2019 |
| WoF Expiry: | 10 Nov 2018 | Odometer: | 291,035 Kms | Good No: | 18344852 |
| VIN: | 7A897130700111879 | Next Service: | | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

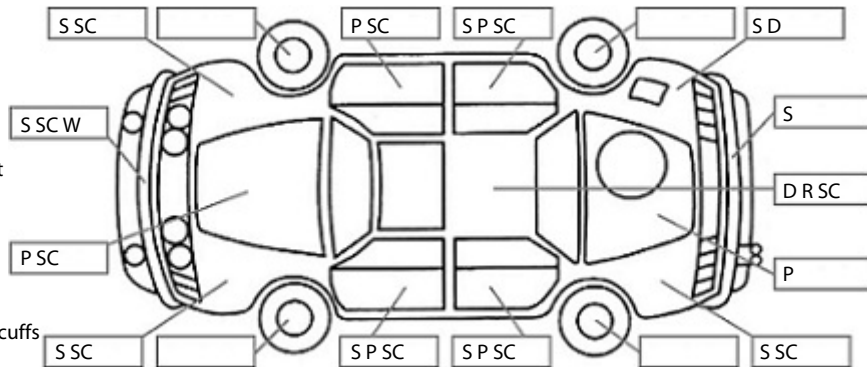

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Moisture in RF indicator. Parking mirror on LF guard is broken. Aerial is broken. LF, RR and RF door weatherstrips are rusty. Rust in back edge of roof air deflector. RH C and D pillars have dents. RF door hinges are worn. Stonechips on windscreen. AC not cold. RH 3rd row seatbelt catch is damaged.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufacturers recommended level, contains only water no additive, suggest coolant change and flush. Recommend all coolant hoses changed. No 4wd, both front outer CVs are not connected into front hubs. Engine has oil seepage. Rear swaybar mounts worn.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Font number plate damaged and held with cable ties. Nudge bar dented. Rust in front RH edge of bonnet. RF seat is worn. LF window not working correctly from either LH or RH door switches. Engine is sluggish, may need service.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt
Evidence of Cam Belt Replacement: Yes

Kms: 269,353

| | Pass | Fail | N/A |
|--|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | | ✓ | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | | ✓ | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 2 | mm | |
| Right front | 2 | mm | |
| Left rear | 2 | mm | |
| Right rear | 1.6 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | | ✓ | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | | | ✓ |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Roger King

Date: 29 Aug 2018

I have read and understood this condition guide.

Name:

Signature: