

Report ID:	28,328,681	Version:	2
Created:	25 Aug 2026		


Make:	Mitsubishi	Model:	Lancer
Body Style:	Sedan	Year:	1992
Rego No.:	HNU878	Rego Expiry:	04 Jun 2026
WoF Expiry:	24 Jul 2026	Odometer:	171,728 Kms
Good No.:	28328681	VIN:	7A8CJ0D0799100694
Next Service:	176,000 kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

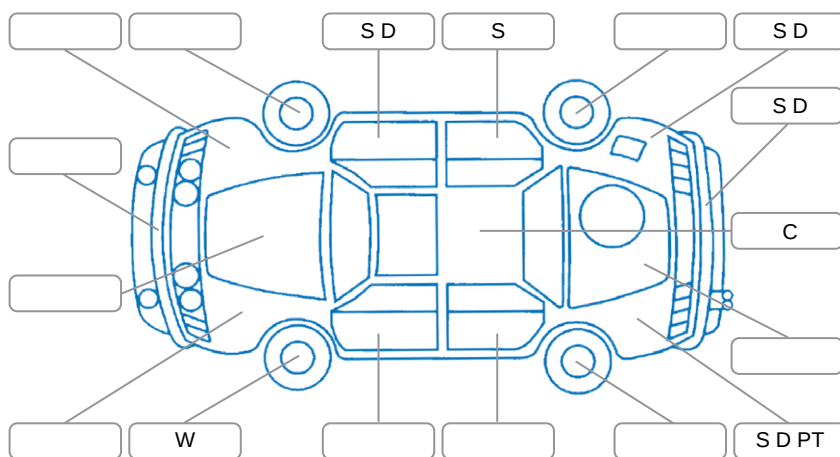

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Windscreen side cover torn, timing chain cover missing, coolant reservoir missing, r front tyre side damage, all wheel cap missing, battery not secured, interior boot a bit rust, rear seat torn, L rear seat belt frayed, L front wheel play.

Conditions During Body Inspection	Wet
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Engine oil leak, underbody some area rust, aftermarket exhaust, front subframe rust, turbo inter cooler not secured, engine rust bend, r inner cv boot split, r front inner guard missing, lower transmission mount split, note: underneath chassis some dent.both front suspension spring loose.

Interior Comments

Seats:	Poor
Carpets:	Poor
Panels:	Poor
Dashboard:	Average

General Comments

Vehicle has been reregistered. Driver seat torn and seat belt frayed,wiper blade weak and washer jet not working, both side speaker cover missing, rattle engine bay, battery light on, wing mirror cover cracked not folding and adjusting, aftermarket air filter and hoses, rpm up and down, air con not cold,

Road Conditions During Test Drive	Wet
Engine Timing Mechanism	Cambelt
Evidence of Cam Belt Replacement	☒ Yes ☐ No 251,000 Kms
Inspected by:	Marlon Espena
Published by:	Syariah Saemo
Inspection Date:	17 Jul 2026

	OK	Requires Attention	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			4.0 mm
Right front			4.0 mm
Left rear			5.0 mm
Right rear			5.0 mm
Spare		Yes	
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers		✓	
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____