


•	Report ID:	26,069,142	Version:	2
	Created:	05 Dec 2025		

	ОК	Requires Attention	N/A
Engine			
Oil level	V		
Smoke & fumes	1		
Engine performance	/		
Noise	1		
Coolant condition	1		
Cooling performance		~	
Radiator / Hoses (visual)	V		
Transmission			
Operation	1		
Noise	/		
Clutch			~
CV joints	1		
Wheel bearings	V		
Brakes	_		
Performance	V		
Hand brake	/		
Tyres (lowest observed tread	depth of	tyres)	
Left front			4 mr
Right front			4.5 mr
Left rear		(6.5 mr
Right rear			6 mr
Spare	Yes		
Suspension	_		
Suspension performance	1		
Steering performance	1		
Shock absorbers	1		
Air Conditioning / Heater			
Operation		V	
Electrical / Accessories			
Head lights	1		
Tail lights	1		
Indicators	1		
Dashboard warning lights	/		
Wipers (front & rear)	1		
Window winder FL	1		
Window winder FR	/		
Window winder RL	1		
Window winder RR	1		
Rear view mirrors	/		
Radio (basic test only)	1		
CD (basic test only)			1
Number of keys	3	•	
Central locking	1		
Remote locking	1		
Sat. nav. (basic test only)			1
Reversing camera	1		

Make:	Holden	Model:	Commodore
Body Style:	Wagon	Year:	2020
Rego No.:	MWN670	Rego Expiry:	15 Jun 2026
WoF Expiry:	16 Jun 2026	Odometer:	187,476 Kms
Good No.:	26069142	VIN:	W0VZM8ECXL1020421
Next Service:	195,000 Kms	Service History:	No

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

rey				
S = Scratch	R = Rust	C = Crack	* = Decals	W = Significant scuffs
D = Dent	PT = Paint defect	P = Pin dent	SC = Stone Chips	

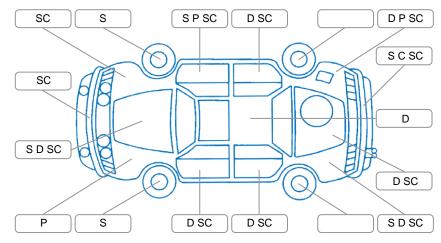

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Holes drilled in front and rear bumpers. Additional aerial port and cut electrical harness on roof. Drivers door seal torn.

LF door bent at bottom of door. Minor dent in LH sill.

LH cant rail dented.

Conditions During Body Inspection

Under Carriage and Under Bonnet Inspection Comments

Coolant leak.

Interior Comm	Interior Comments			
Seats: Good				
Carpets:	Average, holes drilled in passenger footwell.			
Panels:	Average, holes drilled in centre console.			
Dashboard:	Average, holes drilled, steering wheel worn.			

General Comments

Fraying on both front seatbelts.

RR door speaker trim damaged.

AC not cold.

Steering wheel cruise control/speed limiter controls not working.

			· 3	
Road Condition	s During Test Drive	Wet		
Engine Timing I	Mechanism	Timing Chain		
Evidence of Can	n Belt Replacement	Yes	No	Kms
Inspected by:	Lewis Dolamore			
Published by:	Lewis Dolamore			
Inspection Date:	05 Dec 2025			

I have read and understood
this condition guide:

NAME			

N	ATI	IRF		