

Basic Condition Guide

| • | Report ID: | 27,105,952 | Version: | 2 |
|---|------------|-------------|----------|---|
| | Created: | 30 Oct 2025 | | |


| Make: | Mitsubishi | Model: | Pajero |
|---------------|-------------|------------------|-------------------|
| Body Style: | SUV | Year: | 2005 |
| Rego No.: | CQP546 | Rego Expiry: | 29 Jul 2026 |
| WoF Expiry: | 26 Feb 2026 | Odometer: | 238,428 Kms |
| Good No.: | 27105952 | VIN: | JMFLYV77W5J002878 |
| Next Service: | 244,000 | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle ha been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Kev

| Rey | | | | |
|-------------|-------------------|--------------|------------------|------------------------|
| S = Scratch | R = Rust | C = Crack | * = Decals | W = Significant scuffs |
| D = Dent | PT = Paint defect | P = Pin dent | SC = Stone Chips | |

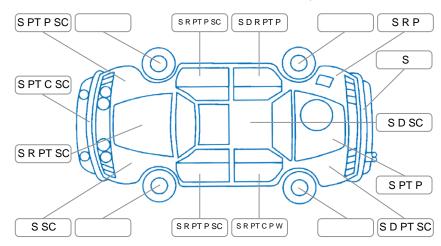

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Right Taillight Cracked, Fog Lights Missing

Sunroof Opening & Frame All Door Sills & Doors Surface Rust

Headlights Faded & Minor Stone Chips Windscreen - Expected for Age & Mileage

| Under Carriage and Under Ronnet Inspection Comme | onts |
|--|------|
| Conditions During Body Inspection | Dry |

Minor Underbody Surface Rust

Left Rear Differential Bushing Split

Minor Coolant Leak from Cooler Lines

Oil, Power Steering & Right Front Upper Ball Joint Seepage

| Interior Comm | ents |
|---------------|---------------------------------------|
| Seats: | Drivers Seat Torn |
| Carpets: | Average |
| Panels: | Average |
| Dashboard: | Average |
| | · · · · · · · · · · · · · · · · · · · |

General Comments

Intermittent Squealing Noise

| Road Conditions During Test Drive | | Dry | | |
|-----------------------------------|----------------------------------|---------|----|-------------|
| Engine Timing Mechanism | | Cambelt | | |
| Evidence of Car | Evidence of Cam Belt Replacement | | No | 213,980 Kms |
| Inspected by: | Samuel Weir | | | |
| Published by: | James Scott | | | |
| Inspection Date | 06 Oct 2025 | | | |

| | ОК | Requires Attention | N/A |
|--------------------------------|--------------|-----------------------|----------|
| Engine | | | |
| Oil level | | V | |
| Smoke & fumes | 1 | | |
| Engine performance | 1 | | |
| Noise | \(\sigma \) | | |
| Coolant condition | / | | |
| Cooling performance | / | | |
| Radiator / Hoses (visual) | | V | |
| Transmission | | 1 | |
| Operation | V | | |
| Noise | _ | | |
| Clutch | | | 1 |
| CV joints | | | 1 |
| Wheel bearings | / | | |
| Brakes | | | |
| Performance | / | | |
| Hand brake | 1 | | |
| Tyres (lowest observed tread d | epth of | tvres) | |
| Left front | | | 0.0 mm |
| Right front | | 1(| 0.5 mm |
| Left rear | | | 1.0 mm |
| Right rear | | | 1.0 mm |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | / | | |
| Steering performance | 1 | | |
| Shock absorbers | 1 | | |
| Air Conditioning / Heater | | | |
| Operation | V | | |
| Electrical / Accessories | | | |
| Head lights | ' | | |
| Tail lights | V | | |
| Indicators | | | |
| Dashboard warning lights | V V | | |
| Wipers (front & rear) | · | | |
| Window winder FL | · · | | |
| Window winder FR | • | | |
| Window winder RL | 1 | | |
| Window winder RR | <i>y</i> | | |
| Rear view mirrors | <i>'</i> | | |
| Radio (basic test only) | <i>'</i> | | |
| | <i>'</i> | | |
| CD (basic test only) | 2 | | <u> </u> |
| Number of keys | ∠ ✓ | Ī | Ι |
| Central locking | <i>'</i> | | |
| Remote locking | | | |
| Sat. nav. (basic test only) | ., | | - |
| Reversing camera | | <u> </u> | |

I have read and understood this condition guide:

NAME SIGNATURE