

Basic Vehicle Condition Guide

Report ID: 25,641,899

Version: 1

Created: 28 Mar 2024

N/A


mm

mm mm mm

Make: Model: Skoda Superb **Body Style:** Sedan Year: 2015 Registration: PMT940 **Reg Expiry:** 01 Apr 2024 **WoF Expiry: Odometer:** 16 Nov 2024 141,000 Kms **Good No:** 25641899 VIN: TMBBF93T7E9023148 Next Service: 146,000km Service History: Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

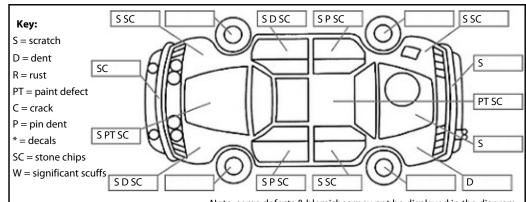

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Clear coat touch up on bonnet. Front number plate damaged. Windscreen has stonechips with cracks forming. Paint on roof has chemical reaction. Rear number plate anchors damaged and only available from Skoda dealerships

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

| <u>Interior Comments</u> | | | | |
|--------------------------|------|--|--|--|
| Seats | Good | | | |
| Carpets | Good | | | |
| Panels | Good | | | |
| Dashboard | Good | | | |

General Comments

Inspected by:

Actual odometer reading at time of inspection 140680km. Navigation requires maps dvd to operate which it does not have. A/c working during inspection. Hood lining sagging.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No

Reuben Harvey

I have read and understood this condition guide.

| | Remote locking | ~ | | | | |
|-------------------|---|---|---|---|--|--|
| | Sat. Nav. (basic test only) Reversing camera | | ~ | | | |
| Kms: | | | | ~ | | |
| Date: 19 Mar 2024 | | | | | | |
| Name: | Signature: | | | | | |

Number of keys

Central locking

2

| | Pass | Fail | |
|------------------------------|----------|---------|----------|
| Engine | | | |
| Oil level | ~ | | |
| Smoke & fumes | ~ | | |
| Performance | ~ | | |
| Noise | ~ | | |
| Cooling System | | | |
| Coolant condition | ~ | | |
| Performance | ~ | | Ī |
| Radiator / Hoses (visual) | ~ | | |
| Transmission | 1 | | _ |
| Operation | ~ | | |
| Noise | ~ | | l |
| Clutch | | | l |
| CV joints | ~ | | |
| Wheel bearings | ~ | | r |
| Brakes | | | <u> </u> |
| Performance | V | | Ī |
| Hand Brake | ~ | | T |
| Tyres (lowest observed tread | d depth | of tyre | es) |
| Left front | | .5 | n |
| Right front | | .5 | n |
| Left rear | | .0 | n |
| Right rear | | .0 | n |
| Spare | | Yes | |
| Suspension | 1 | | |
| Suspension performance | V | | Γ |
| Steering performance | <i>y</i> | | |
| Shock absorbers | <i>y</i> | | - |
| Air Conditioning / Heater | | | _ |
| Operation | ·/ | | Γ |
| Electrical / Accessories | | | |
| Head lights | · / | | Τ |
| Tail lights | ~ | | |
| Indicators | - | | H |
| Dashboard warning lights | <i>V</i> | | \vdash |
| Wipers (front & rear) | V | | |
| Window winder FL | V | | \vdash |
| | <i>'</i> | | |
| Window winder FR | V | | - |
| Window winder RL | V | | L |
| Window winder RR | ~ | - | |
| Rear view mirrors | - | - | \vdash |
| Radio (basic test only) | / | | \vdash |
| CD (basic test only) | / | | 1 |