


<b>Make:</b>	Foton	<b>Model:</b>	View CS2	<b>Body Style:</b>	Van
<b>Year:</b>	2016	<b>Registration:</b>	LAT177	<b>Reg Expiry:</b>	21 May 2024
<b>WoF Expiry:</b>	22 Aug 2024	<b>Odometer:</b>	106,000 Kms	<b>Good No:</b>	25686444
<b>VIN:</b>	LVAC2ZBB8FS044522	<b>Next Service:</b>	no service history	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

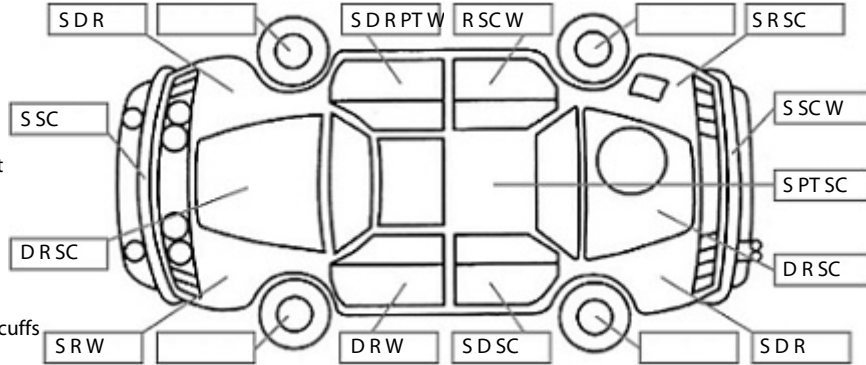

Note: some defects & blemishes may not be displayed in the diagram

**Body Inspection Comments**

Lh headlight and tail light scuffed.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Oil leaks. Major damage to rhr of vehicle is structural. Tailgate vision mirror missing. Bits of decals on body. Both front tyres have excessive edge wear. Clutch a slave cylinder worn. Radiator support bent

**Interior Comments**

Seats	Average. drivers seat has hole with metal exposed.
Carpets	Average
Panels	Average. tail gate door missing panel
Dashboard	Average. some covers missing

**General Comments**

Actual odometer reading at time of inspection 105375kms. Key blade snapped off in ignition. Vehicle needed jump start. Engine cover latch assembly loose fit. Engine light on. Rear parking sensors n/w. Battery passed test. Lh slider door handle assembly glued in place

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	3.0	mm	
Right front	4.5	mm	
Left rear	7.5	mm	
Right rear	3.5	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Reuben Harvey

Date: 11 Apr 2024

I have read and understood this condition guide.

Name: .....

Signature: .....