

Basic Vehicle Condition Guide

Report ID: 16,647,006


Version: 1

Created: 29 Sep 2017

Make: Model: Mitsubishi **Body Style:** Utility Triton Year: Registration: Reg Expiry: 2,006 **DDZ698** 05 Sep 2017 **WoF Expiry: Odometer: Good No:** 16647006 23 Sep 2018 252,532 Kms VIN: MMB0NK7705D06922 **Next Service: Service History:** 247,000 No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

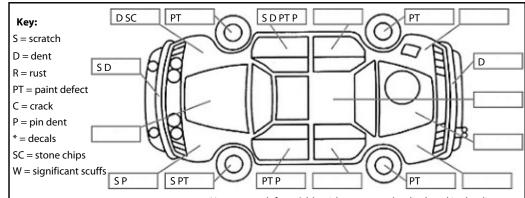

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Rust on inside engine bay on right side of fire wall and on side rear of inner front quarter, under bonnet lip, Door jam, sill scuffs, paint defects, B pillar, paint defects, scuffs, pin dent

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Oil leaks,LF wheel play requires attention,LF shackle spring housing damage,Some under vehicle components have corrosion

Interior Comments				
Seats	Good			
Carpets	Good			
Panels	Good			
Dashboard	Good			

General Comments

Steering wheel noise requires attention, Radio, CD unit require code to operate, Handbrake not working, Engine hard to start when cold,

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Todd Phillips Date: 16 Aug 2017

	_				
	Pass	Fail	N/A		
Engine					
Oil level	~				
Smoke & fumes	~				
Performance		~			
Noise	~				
Cooling System					
Coolant condition	V V				
Performance	~				
Radiator / Hoses (visual)	~				
Transmission					
Operation	~				
Noise	~				
Clutch	~				
CV joints			~		
Wheel bearings	~				
Brakes					
Performance	~				
Hand Brake		~			
Tyres (lowest observed tread	depth	of tyre	es)		
Left front	9	.0	mm		
Right front	4.9		mm		
Left rear	4.0		mm		
Right rear	4.2		mm		
Spare		Yes			
Suspension					
Suspension performance	~				
Steering performance		~			
Shock absorbers	~				
Air Conditioning / Heater					
Operation	~				
Electrical / Accessories					
Head lights	~				
Tail lights	~				
Indicators	v v				
Dashboard warning lights	~				
Wipers (front & rear)		~			
Window winder FL	~				
Window winder FR	~				
Window winder RL			~		
Window winder RR			~		
Rear view mirrors	~				
Radio (basic test only)		~			
CD (basic test only)		~			
Number of keys	1				
Central locking	~				
Remote locking			~		
Sat. Nav. (basic test only)			~		
Reversing camera			~		
		1			

I have read and understood this condition guide.

Name:

Signature: