


Make:	Honda	Model:	Accord	Body Style:	Wagon
Year:	2,002	Registration:	EWQ524	Reg Expiry:	05 Sep 2018
WoF Expiry:	15 Nov 2017	Odometer:	305,793 Kms	Good No:	17085039
VIN:	7A88G130708001551	Next Service:	304,376kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

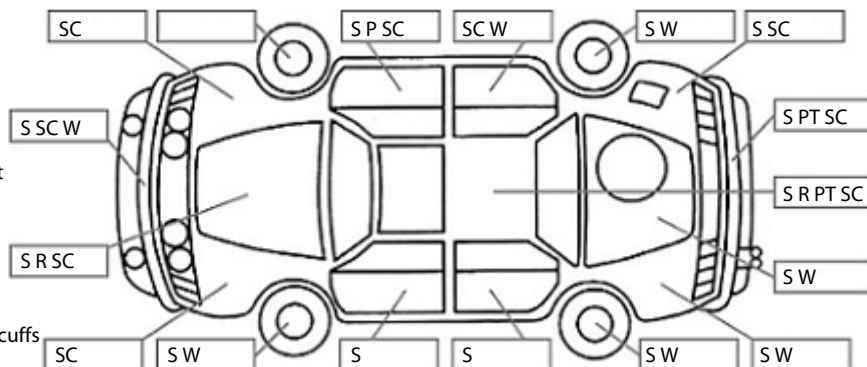

Body Inspection Comments

Missing centre caps on all 4 alloy wheels. Stone chips on front windscreen, 2 are in cva area, so would fail w.o.f. Left rear tail light lens has been cracked, broken & then been glued back together. Left front guard inner plastic panel has had bottom part of it worn off.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Front sway bar links worn. Right rear shock leaking & left rear shock damp. Rear sway bar links worn & sway bar bushes worn. Oil leaking from around engine rocker cover on top of engine.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

General Comments

Hand brake works fine, but need adjustment. A/C not getting cold. Key remote not working to lock & unlock vehicle. Missing cover on inside of tailgate. Knock in front & rear suspension(worn sway bar links & bushes)

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	5.0	mm	
Right front	4.0	mm	
Left rear	2.6	mm	
Right rear	2.8	mm	
Spare	Yes		
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers		✓	
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 13 Apr 2018

I have read and understood this condition guide.

Name:

Signature: