

# **Basic Vehicle Condition Guide**

Report ID: 17,160,238


Version: 1

Created: 16 Jan 2018

Make: Model: **Body Style:** Hatchback Mini Cooper Year: Registration: Reg Expiry: 2,006 **KRE989** 20 Sep 2018 WoF Expiry: **Odometer: Good No:** 17160238 06 Oct 2018 121,344 Kms VIN: WMWRE32020TG9391 **Next Service: Service History:** No

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

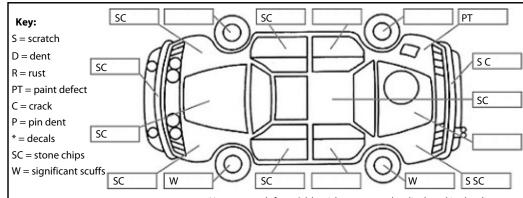

#### **Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Crack in rear bumper RHS. RH taillight lens cracked. Has no jack or tools or spare wheel. Has compressor. Clearcoat damage RR guard. Stonechips on windscreen. Marks on seats. Remote locking not working.

Conditions During Body Inspection: Dry

### **Under Carriage & Under Bonnet Inspection Comments**

Pod filter fitted. Coolant additive concentration below manufactures recomended level suggest coolant change. LH F outer CV boot leaking grease. Engine has oil seepage.

<u>Interior Comments</u>			
Seats	Average		
Carpets	Average		
Panels	Average		
Dashboard	Average		

## **General Comments**

Inspected by:

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Roger King

Evidence of Cam Belt Replacement: Yes

Kms: 105,089

	Pass	Fail	N/A
Engine			•
Oil level	~		
Smoke & fumes	v v		
Performance	~		
Noise	~		
Cooling System			•
Coolant condition	~		
Performance	~		
Radiator / Hoses (visual)	~		
Transmission			•
Operation	~		
Noise	~		
Clutch			~
CV joints	~		
Wheel bearings	~		
Brakes			
Performance	~		
Hand Brake	~		
Tyres (lowest observed tread	depth	of tyre	es)
Left front	ī	5	mm
Right front	ī	5	mm
Left rear	6		mm
Right rear	6		mm
Spare		N/A	
Suspension	•		
Suspension performance	~		
Steering performance	~		
Shock absorbers	~		
Air Conditioning / Heater			
Operation	~		
Electrical / Accessories			
Head lights	~		
Tail lights	~		
Indicators	~		
Dashboard warning lights	\( \times \) \( \t		
Wipers (front & rear)	~		
Window winder FL	~		
Window winder FR	~		
Window winder RL			~
Window winder RR			~
Rear view mirrors	~		
Radio (basic test only)	~		
CD (basic test only)			~
Number of keys	1		
Central locking	~		
Remote locking		>	
Sat. Nav. (basic test only)			~

I have read and understood this condition guide.

Name: .....

Signature: .....

16 Jan 2018

Reversing camera