


<b>Make:</b>	Mazda	<b>Model:</b>	Atenza	<b>Body Style:</b>	Sedan
<b>Year:</b>	2005	<b>Registration:</b>	GZB921	<b>Reg Expiry:</b>	13 Aug 2020
<b>WoF Expiry:</b>	18 Apr 2020	<b>Odometer:</b>	232,370 Kms	<b>Good No:</b>	17655264
<b>VIN:</b>	7AT0C139X13402872	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

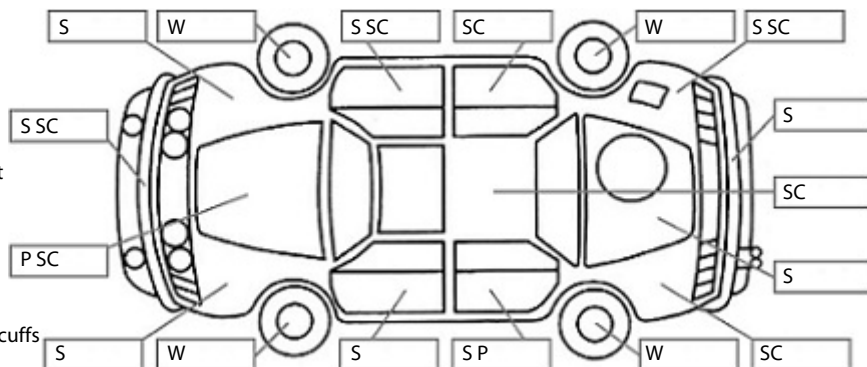

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Suntan lotion damage on paint. LH inner taillight has moisture. Water in spare wheel well. LR wheel has no center cap. Badge missing on tailgate. Stonechips on windscreen. Aerial damaged. RH air vent of the three in center of dash is damaged. Jack cover damaged. Wear on RF seat.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufactures recomended level suggest coolant change. Surface rust on suspension and bumper supports. Inner edge wear LR tyre.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	0.2	mm	
Right front	0.8	mm	
Left rear	2	mm	
Right rear	6	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 17 Oct 2019

I have read and understood this condition guide.

Name: .....

Signature: .....