

Report ID: 17,656,508

Version: 2

Engine Oil level Smoke & fumes

Noise

Performance

Cooling System

Transmission

Operation

Coolant condition Performance

Radiator / Hoses (visual)

Created: 31 Oct 2019

Fail

N/A

Pass


~ 1

/

М	ake:	Toyota	Model:	Prado	Body Style:	Wagon
Y	ear:	2000	Registration:	FAE985	Reg Expiry:	20 Dec 2019
w	oF Expiry:	27 Feb 2020	Odometer:	255,204 Kms	Good No:	17656508
v	IN:	JT711VJ9500077038	Next Service:		Service History: Yes	

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

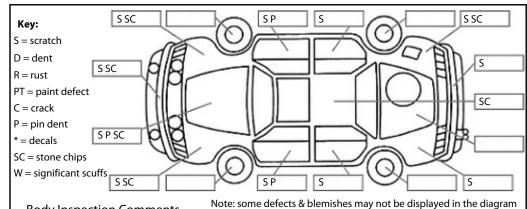

Body Inspection Comments

Sealer? on top edge of tailgate. Rub marks both sides of rear pillars at top, seen with tailgate open. Small dent in RH D pillar. Rubber filler strip coming off RR flare. 2 aerial mounts on LF guard. Unit removed on inside of roof. Wiring exposed on LF passenger area. Ashtray missing rear of console

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Earth cable from vehicle body to battery not connected.

Inner edge wear RF tyre. Engine has oil seepage. LR shock mount rubbers worn. Engine drive belt noisy. Shocks have wear.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Stonechips on windscreen. Aerial damaged.

Wear on RF seat and seatbelt. Wear on steering wheel. AC not cold. Screw holes in dash console. Console not secure.

Drives ok.

Inspected by:

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Roger King

Evidence of Cam Belt Replacement: Kms:

Noise 1 Clutch ~ CV joints Wheel bearings Brakes Performance **Hand Brake** Tyres (lowest observed tread depth of tyres) Left front mm Right front 2 mm Left rear mm Right rear 6 mm Spare Yes Suspension Suspension performance Steering performance 1 Shock absorbers Air Conditioning / Heater Operation **Electrical / Accessories** Head lights Tail lights Indicators Dashboard warning lights / Wipers (front & rear) Window winder FL Window winder FR Window winder RL Window winder RR Rear view mirrors / Radio (basic test only) 1 CD (basic test only) 1 Number of keys 1 Central locking Remote locking Sat. Nav. (basic test only)

I have read a	nd understo	od this cond	ition guide.

31 Oct 2019

Reversing camera