


<b>Make:</b>	Mazda	<b>Model:</b>	Bt-50	<b>Body Style:</b>	Utility
<b>Year:</b>	2007	<b>Registration:</b>	EBQ559	<b>Reg Expiry:</b>	09 Mar 2020
<b>WoF Expiry:</b>	28 Nov 2019	<b>Odometer:</b>	350,474 Kms	<b>Good No:</b>	17656531
<b>VIN:</b>	MM0UNY0E30062773	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

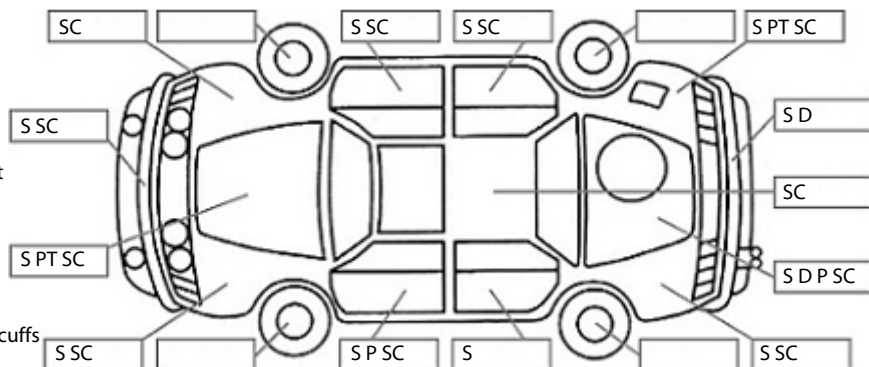

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Crack in LH taillight lens. Surface rust on deck bed. paint coming off around fuel filler. Stonechips on windscreen. Paint lifting in center of bonnet. Filler strips coming off on RH wheel arch flares. RR window winder has issues. AC not cold. No jack or tools. RF seat and seatbelt are worn.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

AC pump seized and belt removed. Outer edge wear LF tyre. Engine has oil seepage. Surface rust on lower edge of radiator support panel. Lower edge of front bumper not secure.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Headlamps need buffing.  
Steering wheel is worn.  
Clutch is heavy.  
Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes

Kms: 304,800

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	4	mm	
Right front	4	mm	
Left rear	3	mm	
Right rear	3	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 31 Oct 2019

I have read and understood this condition guide.

Name: .....

Signature: .....