


Make:	Suzuki	Model:	Grand Vitara	Body Style:	SUV
Year:	2009	Registration:	EZK147	Reg Expiry:	20 Aug 2020
WoF Expiry:	08 Jun 2020	Odometer:	250,107 Kms	Good No:	17657662
VIN:	JSAJTAA4V00102628	Next Service:	258890	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

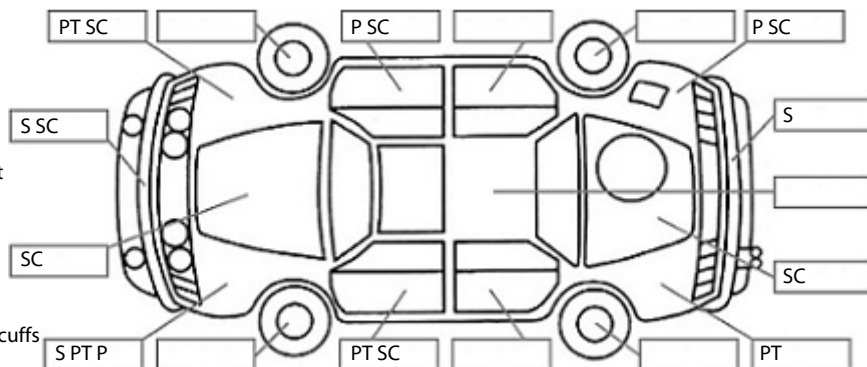

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Poor paint touchup on LF guard. Paint coming off LH door and LR guard trim. Spare wheel cover worn. Screen on stereo not working properly. Screw holes in console and dash. Blanking plate missing in console. Rear seat removed but seatbelts are fitted. Parcel tray missing. RF seat is worn.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Average condition.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

RF door has been opened too far, has damage on front edge from hinge etc. RF check strap not working, possibly damaged. RF guard has paint coming off. Stonechips on windscreen. Wear on steering wheel. Key has damage. M,
Loud road noise coming from type of tyres fitted.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	3	mm	
Right front	4	mm	
Left rear	6	mm	
Right rear	6	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 02 Dec 2019

I have read and understood this condition guide.

Name:

Signature: