


Make:	Ford	Model:	Transit	Body Style:	Van
Year:	2009	Registration:	GWL973	Reg Expiry:	22 Jun 2019
WoF Expiry:	07 Mar 2019	Odometer:	202,325 Kms	Good No:	17699544
VIN:	WF0XXXBDFX8G8705	Next Service:	213000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

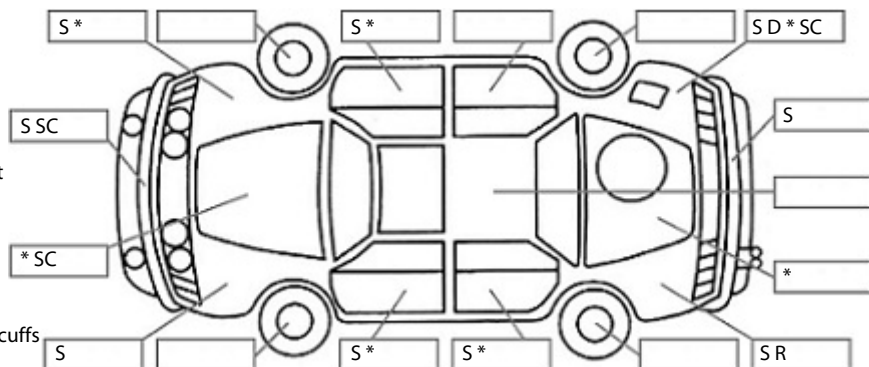

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Damage to LH gutter under front roof rack mount. Surface rust on top rail for LH sliding door. Rust hole in LR guard by sliding door. Scratches on RH taillight. Stonechips on windscreen. Pocket on dash is damaged. Catch broken on RH lid on dash above speedo. Tailgate door card damaged.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufacturers recommended level, contains only water no additive, suggest coolant change and flush. RF swaybar link worn. Gearbox has oil seepage.

LH sill damaged at front.

Interior Comments

Seats	Poor
Carpets	Poor
Panels	Average
Dashboard	Average

General Comments

Both front seats have wear. RF matt is worn brake pedal rubber is worn. Steering wheel is worn. AC not cold. LF door catches on roof rack when opening. No spare wheel.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	9	mm	
Right front	9	mm	
Left rear	9	mm	
Right rear	6	mm	
Spare	No		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 12 Nov 2018

I have read and understood this condition guide.

Name:

Signature: