


Make:	BMW	Model:	X5	Body Style:	SUV
Year:	2004	Registration:	JTH118	Reg Expiry:	28 Nov 2018
WoF Expiry:	28 Apr 2019	Odometer:	235,764 Kms	Good No:	17699585
VIN:	WBAFB52060LT79189	Next Service:		Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

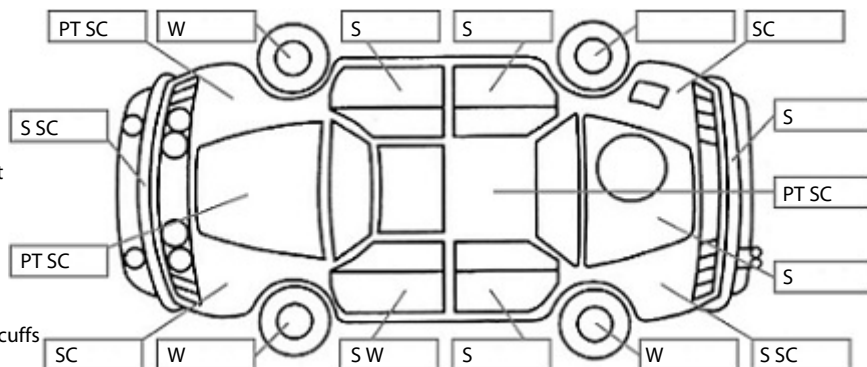

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

RR indicator not going. Tailgate gas struts not working.
Button missing on AC controls. Wear on steering wheel. Damage on RF door card. Lid missing on rear of console. Handle on cover over spare wheel is broken, cannot check for spare wheel etc. CD changer not working. Ashtray damaged on RR door.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant height float missing in overflow bottle. RF outer CV boot torn.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Clearcoat is coming off vehicle. Stonechips on windscreen. Headlamps need buffing. Wear on all seats. Cracks in lens over speedo. Paint coming off roof rack RHS. RF door body rubber is damaged. RH mirror pivot worn.
Battery is low.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints		✓	
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4	mm	
Right front	4	mm	
Left rear	2	mm	
Right rear	2	mm	
Spare	No		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators		✓	
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 06 Nov 2018

I have read and understood this condition guide.

Name:

Signature: