


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Mitsubishi | Model: | Airtrek | Body Style: | SUV |
| Year: | 2003 | Registration: | DJN102 | Reg Expiry: | 06 Sep 2019 |
| WoF Expiry: | 06 Sep 2019 | Odometer: | 131,113 Kms | Good No: | 17700464 |
| VIN: | 7A8CJ3F0706302388 | Next Service: | | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

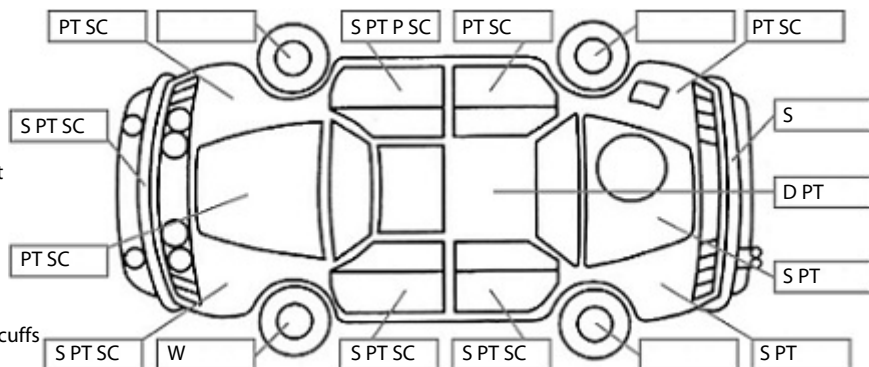

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Clearcoat is coming off vehicle. Bad fading on vehicle. Damage on RH mirror. Stonechips on windscreen. RH taillight cracked.
No wheel brace. Wear on RF seat.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufactures recommended level suggest coolant change.
Recommend changing all coolant hoses. Surface rust under floor.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Car has firm ride. Power steering pump is noisy when turning.
Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 4 | mm | |
| Right front | 5 | mm | |
| Left rear | 3 | mm | |
| Right rear | 3 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | | | ✓ |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Roger King

Date: 13 Dec 2018

I have read and understood this condition guide.

Name:

Signature: