


Make:	Ford	Model:	Telstar	Body Style:	Wagon
Year:	1990	Registration:	PB5864	Reg Expiry:	25 Oct 2019
WoF Expiry:	15 Nov 2019	Odometer:	247,499 Kms	Good No:	17703334
VIN:		Next Service:		Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

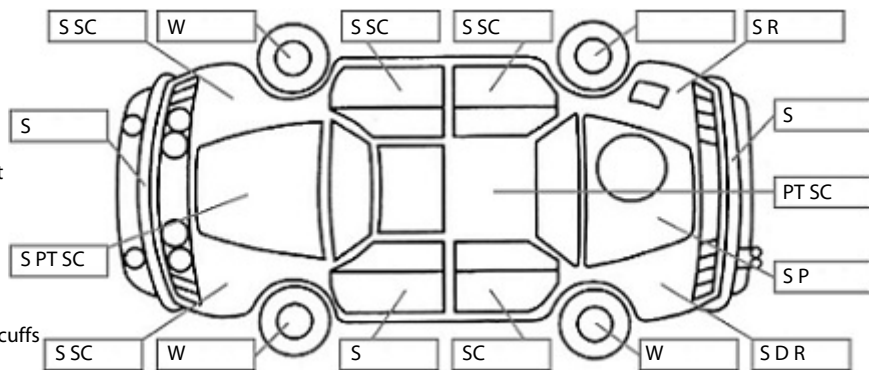

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Paint is worn. Poor paint touchups and overspray all over vehicle. Filler in LF guard. LF door key barrel not working. Rust on LR and RR wheel arches. Rust under tailgate rubber. Wear on RF door card. Wiring loose behind LHS of center console. Some surface rust in spare wheel well.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Rust on LH inner guard below battery. Rust on RHS where shock tower meets firewall, only slight marks on LHS. Coolant additive concentration below manufactures recommended level suggest coolant change. Repair on radiator overflow bottle. Engine has oil seepage. Wear on radiator.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Excessive play in gearlever. Wear on RF seat and seatbelt. Rust marks on under side of RH A pillar, door open. RH mirror broken. RF monsoon cracked. Stonechips and wiper scratch on windscreen. Both rear shocks have oil seepage.

Drives ok. Takes a while to warm up. Possibly no thermostat.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	3	mm	
Right front	2	mm	
Left rear	5	mm	
Right rear	5	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers		✓	
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking			✓
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 10 Jun 2019

I have read and understood this condition guide.

Name:

Signature: