


Make:	Volkswagen	Model:	Beetle	Body Style:	Hatchback
Year:	2000	Registration:	DZS437	Reg Expiry:	15 Jul 2019
WoF Expiry:	02 Jul 2020	Odometer:	280,308 Kms	Good No:	17729541
VIN:	WVWZZZ9CZ1M60111	Next Service:		Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

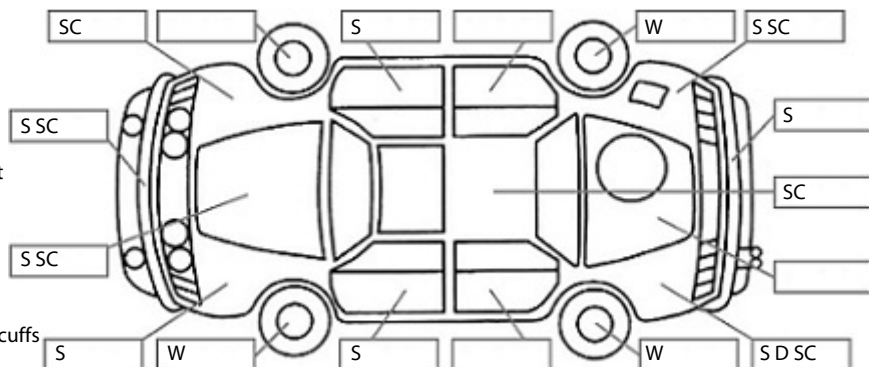

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

LH door, rear bumper and RR guard are different colour

Roof lining coming off. Marks on dash pad. Surround around speedo not secure. Steering wheel has wear. Console lid missing. Button missing on stereo. LH window switch on RF door not working. Paint coming off inside doors. Both door cards worn.

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufactures recommended level suggest coolant change. Engine has oil leaks. Engine oil dipstick tube broken and repaired.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Stonechips on windscreen. Lower section of front bumper held with screws. LH sill dented, front section of LR guard damaged. RH sill damaged from jack multiple times. RF seat and seatbelt are worn. Console scratched and has cracks. All tyres have edge wear.

Drives ok.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	1.7	mm	
Right front	3	mm	
Left rear	2	mm	
Right rear	3	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 03 Jul 2019

I have read and understood this condition guide.

Name:

Signature: