


| | | | | | |
|--------------------|-----------------|----------------------|-------------|-------------------------|-------------|
| Make: | Ford | Model: | Transit | Body Style: | Van |
| Year: | 2012 | Registration: | GQE594 | Reg Expiry: | 06 Apr 2019 |
| WoF Expiry: | 23 Jul 2020 | Odometer: | 261,837 Kms | Good No: | 17734266 |
| VIN: | WF0XXXTFXC56111 | Next Service: | 276000 | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

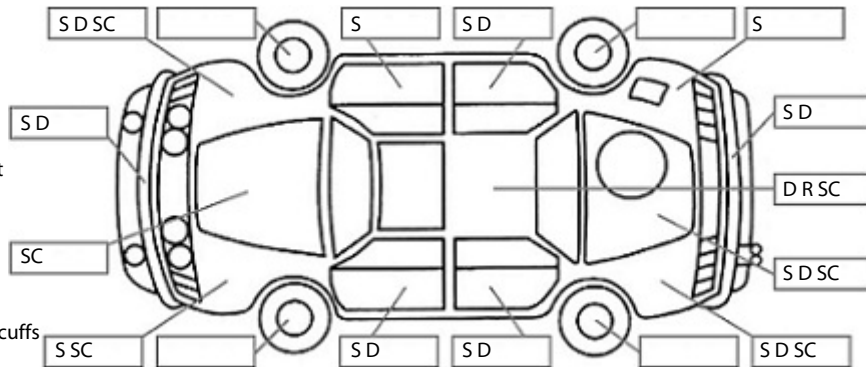

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Lower door striker mounting panel damaged for rear doors. Trim missing below fuel filler lid. Outer handle not working on RH sliding door. RF guard damaged. Water damage to boards inside cargo area LR. Trim inside RH sliding door damaged. RF door rubber damaged. RF seat and RF floor mat is worn.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Has not been viewed on a hoist.

Coolant additive concentration below manufactures recommended level suggest coolant change. Air intake pipe is torn before air filter.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Rust starting on roof above windscreen. Rust on sills below doors. Gear lever boot not secure

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | ✓ | | |
| CV joints | | | ✓ |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 2 | mm | |
| Right front | 3 | mm | |
| Left rear | 1.7 | mm | |
| Right rear | 2 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | | | ✓ |
| Window winder RR | | | ✓ |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Roger King

Date: 06 Aug 2019

I have read and understood this condition guide. Name: Signature: