

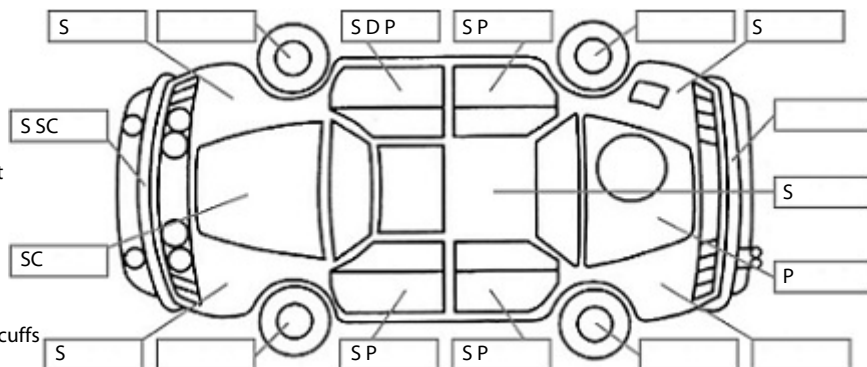
Make:	Daihatsu	Model:	Charade	Body Style:	Hatchback
Year:	2003	Registration:	FTP995	Reg Expiry:	06 Mar 2019
WoF Expiry:	16 Mar 2019	Odometer:	145,041 Kms	Good No:	17796245
VIN:	JDAL251S001005615	Next Service:	148,352kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs


Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Vehicle is missing hub caps off all wheels.
- Plastic cover missing off right side wing mirror.
- Bottom rear corner edge of right front door is bent inwards.
- Missing left side rubber moulding on roof of vehicle.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Minor oil leak from around right side, engine sump pan & between engine & gearbox area.
- Right & left side outer cv boots are starting to split.
- Writing on cam belt sticker has worn off.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

General Comments

- Carpet is torn on right front on drivers side & is coming unattached around front left area.
- Cloth trim on left front interior door trim has come unstuck & cloth trim on right rear door is damaged.
- Drivers seat fabric has pulled threads.
- Plastic trim on side off left front seat.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4.0	mm	
Right front	4.0	mm	
Left rear	4.1	mm	
Right rear	4.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 30 Jan 2019

I have read and understood this condition guide.

Name:

Signature: