


<b>Make:</b>	Ford	<b>Model:</b>	Territory	<b>Body Style:</b>	SUV
<b>Year:</b>	2014	<b>Registration:</b>	HSW887	<b>Reg Expiry:</b>	09 Apr 2019
<b>WoF Expiry:</b>	10 Nov 2019	<b>Odometer:</b>	86,507 Kms	<b>Good No:</b>	17797075
<b>VIN:</b>	6FPAAAJGATEU65129	<b>Next Service:</b>	82,000kms	<b>Service History:</b>	Yes

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

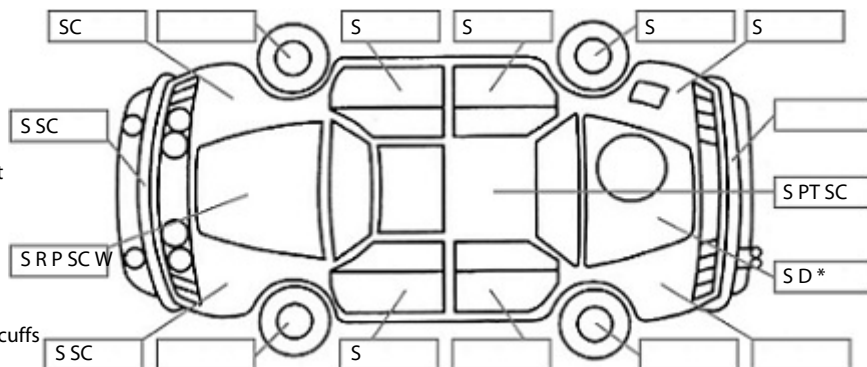

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Small stone crack in middle of windscreen.
- Stone chips in windscreen.
- Paint reaction on right rear corner of roof.
- Inside edge on left front tyre is worn.
- Right rear tyre needs replaced. below legal tread depth.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

- Front brake pads wearing very low, will need replaced.

## Interior Comments

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

## General Comments

- Dvd player is missing remote & head phones.
- Dvd was not tested.
- Marks in leather on base of rear seat.
- Left rear indicator is not working.
- Part of the badge on rear tailgate is missing.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance		✓	
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	3.0	mm	
Right front	2.0	mm	
Left rear	2.0	mm	
Right rear	1.2	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators		✓	
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)	✓		
Reversing camera	✓		

Inspected by: Jason Young

Date: 30 Apr 2019

I have read and understood this condition guide.

Name: .....

Signature: .....