


Make:	Mitsubishi	Model:	Triton	Body Style:	Utility
Year:	2011	Registration:	GDR191	Reg Expiry:	01 Jul 2019
WoF Expiry:	29 Nov 2019	Odometer:	191,685 Kms	Good No:	17797774
VIN:	MMAJNKA40BD00740	Next Service:	197,169kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

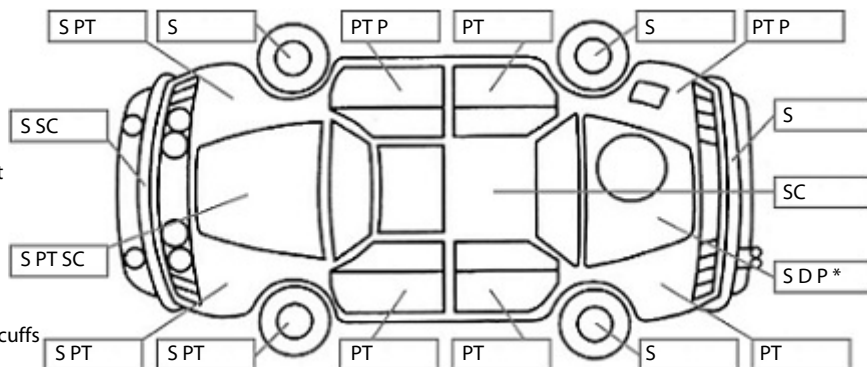

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Marks on most panels in paintwork from where stickers have been stuck to vehicle.
- Screw hole on inside lip of right front & left front guards, where aerials have been attached to ute.
- Crack in left rear tail light lens.
- Badge missing off tailgate. Left front wheel centre cap is missing.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Plastic Intake pipe on air box has a broken clip & vibrates on radiator shroud

Interior Comments

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

General Comments

- Screw holes in dashboard.
- One of key remotes not working to lock & unlock vehicle.
- Left front wheel is wrong size tyre fitted.
- Has no spare wheel.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 185,000

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	9.0	mm	
Right front	6.6	mm	
Left rear	4.9	mm	
Right rear	5.0	mm	
Spare	No		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 13 Mar 2019

I have read and understood this condition guide.

Name:

Signature: