

Basic Vehicle Condition Guide

Report ID: 17,799,021

Pass

~

~

1

Version: 1

Engine

Oil level

Noise

Smoke & fumes

Performance

Cooling System

Created: 09 May 2019


Fail

N/A

Make: Model: Mazda Bt-50 **Body Style:** Utility Year: 2013 Registration: GYM40 **Reg Expiry:** 25 Jun 2019 WoF Expiry: **Odometer:** 01 Jul 2019 96,130 Kms **Good No:** 17799021 VIN: MM0UP0YF10016765 **Next Service:** 94,800kms Service History:

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

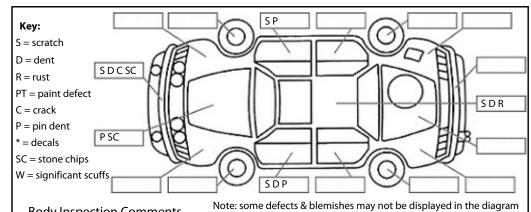

Body Inspection Comments

- , , , , ,
- Dents in right & left front corners of bumper & crack in bottom edge of front bumper crack.
 Small crack in front grille.
- Clip broken on left side of front bumper, where it fits to the guard.
- Tool box door on left side of deck has a dent in it & is not closing correctly.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Small dent in right side sill, under drivers door.

| <u>Interior Comments</u> | | | |
|--------------------------|------|--|--|
| Seats | Good | | |
| Carpets | Good | | |
| Panels | Good | | |
| Dashboard | Good | | |

General Comments

- Lock on lid that fits over jack & tools, under left rear seat is broken.
- Plastic trim panel on side of drivers seat is crack & broken.
- Clip is broken on trim panel on side of left front seat.
- Wee split starting in dashboard, around top of air bag cover.
- Small rip in tonneau cover.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

| Coolant condition | ~ | | | |
|--------------------------------------|--|---------|-----|--|
| Performance | V | | | |
| Radiator / Hoses (visual) | ~ | | | |
| Transmission | | | | |
| Operation | ~ | | | |
| Noise | ~ | | | |
| Clutch | \(\times \) | | | |
| CV joints | ~ | | | |
| Wheel bearings | ~ | | | |
| Brakes | | | | |
| Performance | ~ | | | |
| Hand Brake | ~ | | | |
| Tyres (lowest observed tread | d depth | of tyre | es) | |
| Left front | 5 | .6 | mm | |
| Right front | 5.8 | | mm | |
| Left rear | 7.0 | | mm | |
| Right rear | 4.6 | | mm | |
| Spare | | Yes | | |
| Suspension | | | | |
| Suspension performance | ~ | | | |
| Steering performance | ~ | | | |
| Shock absorbers | ~ | | | |
| Air Conditioning / Heater | | | | |
| Operation | ~ | | | |
| Electrical / Accessories | | | | |
| Head lights | ~ | | | |
| Tail lights | ~ | | | |
| Indicators | ~ | | | |
| Dashboard warning lights | \(\times \) \(\t | | | |
| Wipers (front & rear) | ~ | | | |
| Window winder FL | ~ | | | |
| Window winder FR | ~ | | | |
| Window winder RL | | | ~ | |
| Window winder RR | | | ~ | |
| Rear view mirrors | ~ | | | |
| Radio (basic test only) | ~ | | | |
| · | ~ | | | |
| CD (basic test only) | | | | |
| CD (basic test only) Number of keys | 2 | | | |
| | 2 | | | |
| Number of keys | 2 •• | | | |
| Number of keys Central locking | 2 v | | · | |

Inspected by: Jason Young Date: 09 May 2019