


Make:	Nissan	Model:	Lafesta	Body Style:	SUV
Year:	2005	Registration:	GSR752	Reg Expiry:	13 Jul 2019
WoF Expiry:	18 Jul 2019	Odometer:	169,750 Kms	Good No:	17799045
VIN:	7AT0DH7DX1301122E	Next Service:	?	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

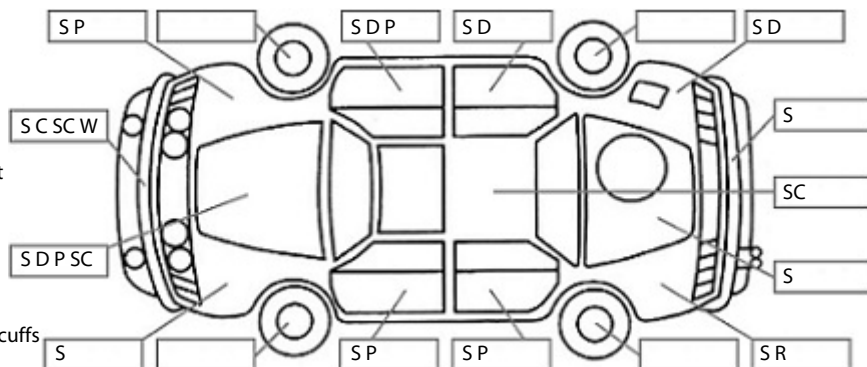

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Small stone crack in drivers viewing area of screen, would need repaired to pass a w.o.f.
- Stone chips in windscreen.
- Crack in middle of front bumper.
- Clip broken on left side of front bumper.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Minor oil leak from right side of engine & around engine sump pan.
- Tools for vehicle jack are missing.

Interior Comments

Seats	Average
Carpets	Average
Panels	Good
Dashboard	Average

General Comments

- Engine idles is very erratic.
- Air bag light keeps flashing.
- Transmission is not very smooth on change down.
- Left rear gas strut on tailgate is bent.
- Seats, carpets & seat belts are dirty & stained.
- Steering wheel cover is worn.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance		✓	
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4.0	mm	
Right front	4.0	mm	
Left rear	5.3	mm	
Right rear	3.8	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 04 May 2019

I have read and understood this condition guide.

Name:

Signature: