

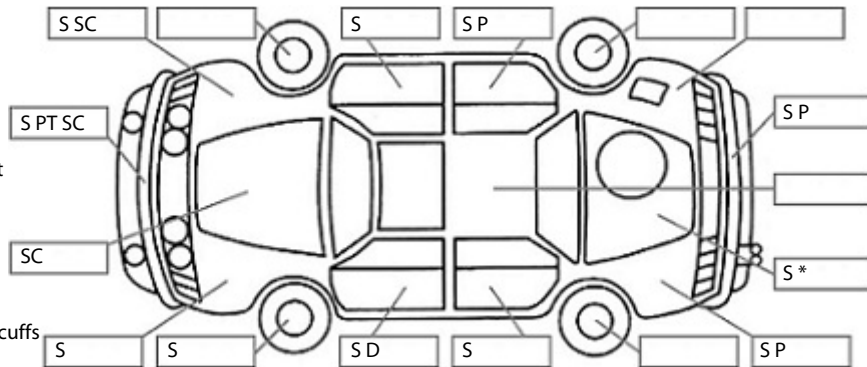
| | | |
|--------------------------------|---------------------------------|--------------------------------|
| Make: Nissan | Model: Sunny | Body Style: Sedan |
| Year: 2004 | Registration: EYZ654 | Reg Expiry: 30 Apr 2020 |
| WoF Expiry: 19 Mar 2020 | Odometer: 189,331 Kms | Good No: 17799406 |
| VIN: 7A8DH140709395520 | Next Service: 196,703kms | Service History: No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs


Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Plastic interior trim missing on inside of right rear door.
- Small hole in front bumper.
- 2 x Small stone cracks in windscreen.
- Left side wing mirror cover has a bit broken off it.
- Monsoon shield on left front door is broken.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Scratch in glass of left side rear door window.
- Right side rear bumper is not fitting correctly.
- Centre console arm rest lid is broken.
- Transmission is not very smooth between some gear changes, advise service.
- Bushes at top of both rear shocks are worn.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Good |
| Dashboard | Good |

General Comments

- Drivers seat belt webbing is worn & is very dirty.
- Left front door electric window is not working.
- Left rear door window is only going up with master switch on drivers door.
- Head lining is dirty & stained.
- Left front seat foam has worn out & fabric is rubbing on seat frame.
- Key remote is not working.
- Radio is not picking up any radio stations.

Road Conditions During Test Drive: Dry

 Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 3.5 | mm | |
| Right front | 3.0 | mm | |
| Left rear | 5.6 | mm | |
| Right rear | 5.3 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | | ✓ | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | | ✓ | |
| Window winder FR | ✓ | | |
| Window winder RL | | ✓ | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | | ✓ | |
| CD (basic test only) | | | ✓ |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | | ✓ | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Jason Young

Date: 14 May 2019

I have read and understood this condition guide. Name: Signature: