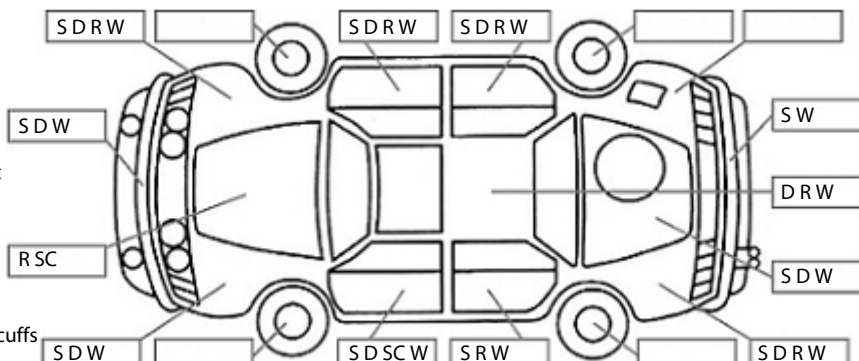


Make: Toyota	Model: Hiace	Body Style: Van
Year: 1996	Registration: BUE193	Reg Expiry: 26 Aug 2019
WoF Expiry: 20 Jun 2019	Odometer: 270,812 Kms	Good No: 17799835
VIN: 7A8H60F0804125338	Next Service: 264,000 kms	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

<p>Key: S = scratch D = dent R = rust PT = paint defect C = crack P = pin dent * = decals SC = stone chips W = significant scuffs</p>	
<p>Body Inspection Comments</p> <ul style="list-style-type: none"> - Left wing mirror missing. - Rear view mirror is worn. - L/front headlight cracked. - Windscreen has major crack. - Fuel latch broken. fuel door can be opened from outside. 	
<p>Note: some defects & blemishes may not be displayed in the diagram</p>	

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Oil leaking between engine and gear box.
- Oil around oil cap on engine (possibly spillage when topping oil up).
- Clutch starting to slip underload.
- Needs serviced, advised flush for coolant.

Interior Comments	
Seats	Poor
Carpets	Poor
Panels	Average
Dashboard	Average

General Comments

- Spare tyre looks worn.
- Interior seal for boot is torn.
- Radio not working.
- Holes in drivers seat & passenger seat.
- Trims missing on dash.
- Flooring torn in places.
- Sun Visors torn & worn.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt
 Evidence of Cam Belt Replacement: Yes Kms: 79,869

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	5.1	mm	
Right front	5.8	mm	
Left rear	7.2	mm	
Right rear	7.4	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors		✓	
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	2		
Central locking		✓	
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Anna-Lise Ferguson Date: 05 Jun 2019

I have read and understood this condition guide. Name: Signature: