

Basic Vehicle Condition Guide

Report ID: 17,819,799


Version: 2

Created: 16 Dec 2019

Make: Model: Holden Crewman **Body Style:** Utility Year: 2006 Registration: DJP844 **Reg Expiry:** 17 Sep 2019 WoF Expiry: **Odometer:** 20 Aug 2020 206,669 Kms **Good No:** 17819799 VIN: 6G1ZK34B46L556698 **Next Service:** Service History: Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

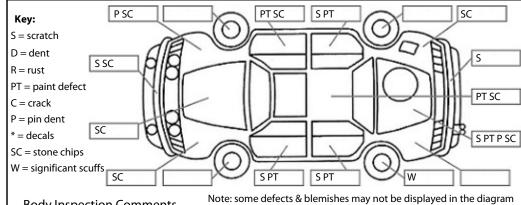

Body Inspection Comments

All door handles and fuel flap have paint damage. Clearcoat coming off vehicle. Stonechips and wiper scratch on windscreen. No Tonneau cover. Cracks in both front side upper trims on deck.

Mirrors not adjusting correctly. Wear on RF seat and seatbelt.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufacturers recommended level, suggest coolant change. Engine has oil seepage.

| Interior Commen | <u>ts</u> |
|-----------------|---------------|
| Seats | wear and tear |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

button covers on both keys are gone, Engine running rough at idle. 1st to 2nd change a little harsh when cold, may need service.

Vehicle is lowered.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

16 Dec 2019 Inspected by: Roger King

| | Pass | Fail | N/A |
|--------------------------------|--|---------|-----|
| Engine | • | • | |
| Oil level | ~ | | |
| Smoke & fumes | \(\times \) | | |
| Performance | ~ | | |
| Noise | ~ | | |
| Cooling System | | | |
| Coolant condition | ~ | | |
| Performance | V | | |
| Radiator / Hoses (visual) | ~ | | |
| Transmission | • | ! | |
| Operation | ~ | | |
| Noise | ~ | | |
| Clutch | | | ~ |
| CV joints | ~ | | |
| Wheel bearings | ~ | | |
| Brakes | | | |
| Performance | ~ | | |
| Hand Brake | ~ | | |
| Tyres (lowest observed tread | d depth | of tyre | es) |
| Left front | | 5 | mm |
| Right front | | 5 | mm |
| Left rear | 4 | | mm |
| Right rear | : | 3 | mm |
| Spare | | Yes | |
| Suspension | | | |
| Suspension performance | ~ | | |
| Steering performance | ~ | | |
| Shock absorbers | ~ | | |
| Air Conditioning / Heater | ļ | ļ | - |
| Operation | ~ | | |
| Electrical / Accessories | l | | |
| Head lights | ~ | | |
| Tail lights | ~ | | |
| Indicators | ~ | | |
| Dashboard warning lights | \(\times \) \(\t | | |
| Wipers (front & rear) | ~ | | |
| Window winder FL | ~ | | |
| Window winder FR | ~ | | |
| Window winder RL | ~ | | |
| Window winder RR | ~ | | |
| Rear view mirrors | ~ | | |
| Radio (basic test only) | ~ | | |
| CD (basic test only) | ~ | | |
| Number of keys | 2 | | |
| l | | | 1 |
| Central locking | V | | 1 |
| Central locking Remote locking | V V | | |

I have read and understood this condition guide.

Name:

Signature:

Reversing camera