


Make:	Hyundai	Model:	Getz	Body Style:	Hatchback
Year:	2004	Registration:	BZG361	Reg Expiry:	29 Feb 2020
WoF Expiry:	20 Apr 2020	Odometer:	262,952 Kms	Good No:	17990459
VIN:	KMHBT51HR4U207051	Next Service:	266,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

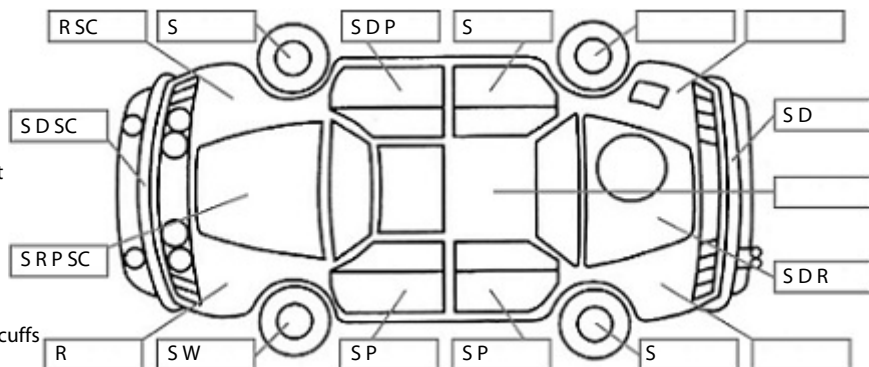

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Hole in carpet in right front, under drivers feet.
- Rubber is missing out of steering wheel cover.
- Stone chips in windscreen.
- Outside edge of left front tyre is worn.
- Small dent & scratches on top edge of left side sill.

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

- Minor oil leak from right side of engine.
- Rocker cover gasket is weeping oil.
- Inside edge of right rear tyre is worn.

Interior Comments

Seats	Good
Carpets	Average
Panels	Good
Dashboard	Good

General Comments

- Right rear brake light is not working.
- Headrest on left rear of back seat is missing.
- Left rear door electric window switch is not working, still works from master control on drivers door.
- Radio/cd player is not working.
- Parcel tray in boot is cracked & broken.
- Electric wing mirrors are not working.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 200,000

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise		✓	
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	2.3	mm	
Right front	2.5	mm	
Left rear	4.0	mm	
Right rear	3.8	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL		✓	
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 30 Jul 2019

I have read and understood this condition guide.

Name:

Signature: