


Make:	Toyota	Model:	Corolla	Body Style:	Wagon
Year:	2007	Registration:	ENC561	Reg Expiry:	30 Aug 2019
WoF Expiry:	10 Jun 2020	Odometer:	405,230 Kms	Good No:	17990519
VIN:	JTDER22E703194444	Next Service:	412,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

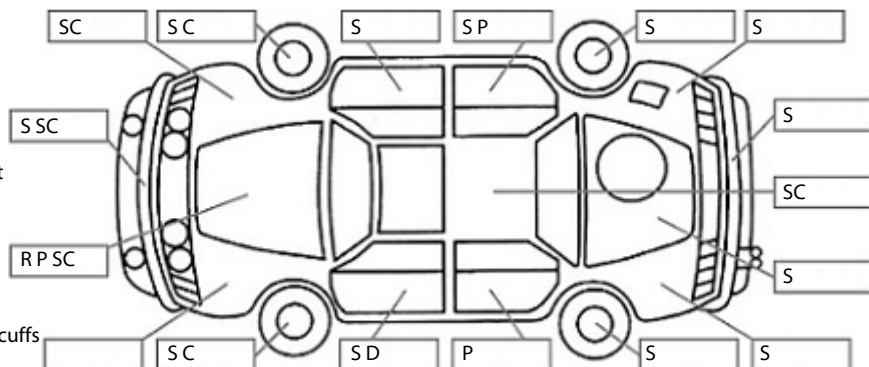

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Small pin dents along right & left side sills.
- Right lower front bumper trim insert is broken off & is sitting in boot, left side trim is missing.
- Left front inner guard panel is missing.
- Stone chips in windscreen.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Oil leak from right rear side of engine.
- Minor oil leak around right side of rocker cover gasket.
- Road noise from left rear wheel.
- Left rear wheel rim is buckled & uneven tread wear on left rear tyre, which is scalloped out.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

- A/C is not getting cold, needs attention.
- Screw holes in left side of centre console.
- Carpeted base boards in cargo area are bent & broken.
- All seat fabric & carpets are dirty & stained.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	3.6	mm	
Right front	3.5	mm	
Left rear	5.4	mm	
Right rear	6.0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 02 Aug 2019

I have read and understood this condition guide.

Name:

Signature: