

## **Basic Vehicle Condition Guide**

Report ID: 17,991,536


Version: 1

Created: 14 Nov 2019

Make: Model: Subaru Outback **Body Style:** SUV Year: 2015 Registration: JFU673 **Reg Expiry:** 22 Jan 2020 WoF Expiry: **Odometer:** 17 Jul 2020 157,023 Kms **Good No:** 17991536 VIN: JF2BS9KC2FG008999 Next Service: 151,900kms Service History:

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

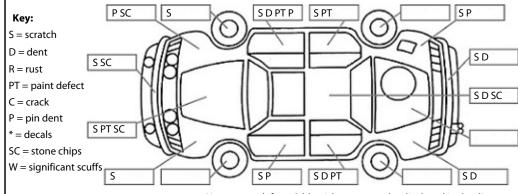

## **Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Stone chips in windscreen. Plastic trim broken off left rear guard. Outside edge worn on left front tyre.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments** 

<u>Interior Comments</u>			
Seats	Average		
Carpets	Good		
Panels	Average		
Dashboard	Average		

## **General Comments**

Engine oil level is below the low mark on engine dip stick. Small cut in seat fabric on left rear base of back seat. Panels in boot area are scratched up & cargo blind has the handle broken off it. Fuse box in right side lower dash has the cover taken off as its broken & will not stay closed.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Jason Young Date: 11 Nov 2019

Name: .....

	Pass	Fail	N/A
Engine	•	•	
Oil level		~	
Smoke & fumes	~		
Performance	~		
Noise	~		
Cooling System			
Coolant condition	~		
Performance	~		
Radiator / Hoses (visual)	\( \triangle \)		
Transmission	Į.	!	
Operation	~		
Noise	~		
Clutch			~
CV joints	~		
Wheel bearings	~		
Brakes			
Performance	<b>'</b>		
Hand Brake	~		
Tyres (lowest observed tread	d depth	of tyre	L es)
Left front	I	.0	mm
Right front			mm
Left rear	3.0		mm
Right rear	4.0		mm
Spare		Yes	
Suspension		103	
Suspension performance	<b>V</b>		
Steering performance	·		
Shock absorbers	<i>'</i>		
Air Conditioning / Heater	_		
Operation	./		
Electrical / Accessories			
Head lights	./		
Tail lights	~		
Indicators			
Dashboard warning lights			
Wipers (front & rear)	\( \times \) \( \t		
Window winder FL			
Window winder FR			
Window winder RL			
	-		
Window winder RR	\( \times \)		
Rear view mirrors	<i>'</i>		
Radio (basic test only)			
CD (basic test only)	~		
Number of keys	2		1
Central locking	<b>'</b>		
Remote locking	~		
Sat. Nav. (basic test only)			~
Reversing camera	<b>'</b>		
neversing camera	10		

Signature: .....