

Basic Vehicle Condition Guide

Report ID: 17,995,620


Version: 2

Created: 07 Nov 2018

Make: Model: **Body Style:** SUV Toyota **Alphard** Year: Registration: **JUU930 Reg Expiry:** 2005 27 Nov 2018 WoF Expiry: **Odometer: Good No:** 09 Nov 2018 194,321 Kms 17995620 VIN: **Next Service: Service History:** 7AT0H64EX16099862 199,300kms

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

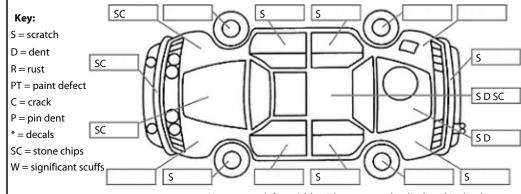

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Plastic panel on bottom of left front door has a broken clip & is not fitting correctly. Stone chips in windscreen. Outside edge worn on left front tyre. Crack in right rear reversing light lens.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Minor oil leak from gearbox. Minor oil leak from right side of engine. Front brake disc/rotors worn & front brake pads wearing low.

<u>Interior Comments</u>				
Seats	Good			
Carpets	Good			
Panels	Good			
Dashboard	Good			

General Comments

Plastic casing on key is cracked & broken. Key has been taped up. Left side door not opening or closing with remote button or from button on right side of dashboard. Fabric trim on side of drivers seat is worn.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Jason Young Date: 07 Nov 2018

Name:

	Pass	Fail	N/A
Engine			
Oil level	~		
Smoke & fumes	\(\times \)		
Performance	~		
Noise	~		
Cooling System			
Coolant condition	~		
Performance	V		
Radiator / Hoses (visual)	~		
Transmission			
Operation	~		
Noise	~		
Clutch			~
CV joints	~		
Wheel bearings	~		
Brakes			
Performance	~		
Hand Brake	~		
Tyres (lowest observed tread	d depth	of tyre	es)
Left front	2		mm
Right front	1.5		mm
Left rear	5.2		mm
Right rear	5		mm
Spare		Yes	
Suspension			
Suspension performance	~		
Steering performance	~		
Shock absorbers	~		
Air Conditioning / Heater			
Operation	~		
Electrical / Accessories			
Head lights	~		
Tail lights	~		
Indicators	~		
Dashboard warning lights	~		
Wipers (front & rear)	~		
Window winder FL	~		
Window winder FR	~		
Window winder RL	V V V V		
Window winder RR	~		
Rear view mirrors	~		
Radio (basic test only)	~		
CD (basic test only)	~		
Number of keys	1		
Central locking	~		
Remote locking	~		
Sat. Nav. (basic test only)	~		
Reversing camera	~		

Signature: