

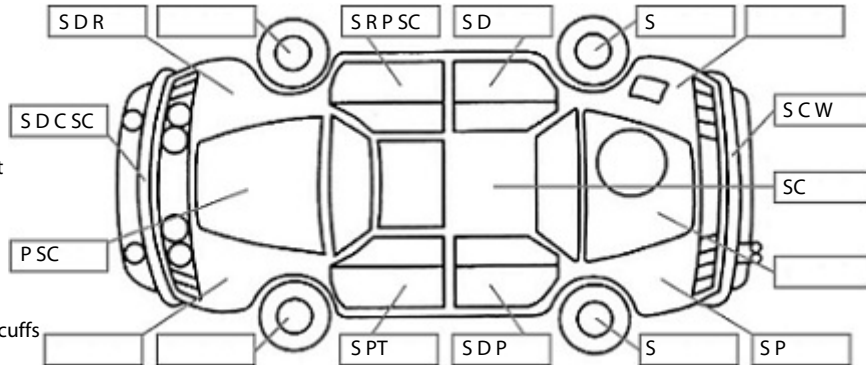
Make: Hyundai	Model: Iload	Body Style: Van
Year: 2014	Registration: HGN953	Reg Expiry: 23 May 2019
WoF Expiry: 15 Mar 2020	Odometer: 163,122 Kms	Good No: 17997129
VIN: KMFWBX7KLEU61390	Next Service: 174,000kms	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs


Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- A crack & hole in right front corner of front bumper.
- Right rear corner of rear bumper is cracked, bent out of shape & not fitting correctly.
- Right rear corner backing sensor has been pushed inside bumper.
- Dent in right side sill, under drivers door & a small dent in left side sill.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Oil leak around engine sump pan & from between engine & gearbox.

Interior Comments

Seats	Average
Carpets	Good
Panels	Good
Dashboard	Good

General Comments

- One of key remotes are not working to lock & unlock vehicle.
- Small hole & fabric is worn on base of drivers seat.

Road Conditions During Test Drive: Dry

 Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	5.2	mm	
Right front	5.2	mm	
Left rear	5.3	mm	
Right rear	7.5	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 09 Aug 2019

I have read and understood this condition guide. Name: Signature: