

Basic Vehicle Condition Guide

Report ID: 17,997,281

Pass

1

/

Version: 1

Engine

Oil level

Noise

Smoke & fumes

Performance

Cooling System

Created: 19 Aug 2019


Fail

N/A

Make: Model: Ford Courier **Body Style:** Utility Year: 2006 Registration: DJL257 **Reg Expiry:** 29 Jul 2020 WoF Expiry: **Odometer: Good No:** 24 Jan 2020 163,112 Kms 17997281 VIN: MNABS1E406W51429 Next Service: 170,470kms Service History:

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

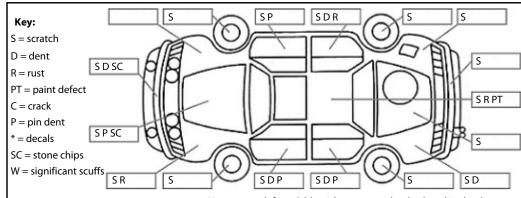

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

- Monsoon shield on drivers door is cracked & broken.
- Dent in bottom of right rear door & body filler has crack out of it & panel has started to rust.
- Left side rear deck gate is bent & twisted out of shape.
- Left front indicator lens is cracked.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

- Dents along left side sill.
- Rear tipper deck is very slow to come back down, needs weight on it to get it down.

Interior Comment	<u>S</u>
Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Inspected by:

- Foam in base of drivers seat is worn, fabric is worn.
- Leather gearshift boot is torn.
- Clear plastic screen over speedo has a crack in it.
- Both rear seat bases are missing.
- Heater vents fins in centre of dashboard are broken.

Road Conditions During Test Drive:	Dry	
Engine Timing Mechanism: Car Evidence of Cam Belt Replacement:	nbelt No	Kms:
Evidence of cam belt replacement.	110	10113.

Coolant condition	~		
Performance	~		
Radiator / Hoses (visual)	~		
Transmission			
Operation	~		
Noise	VVV		
Clutch	~		
CV joints	~		
Wheel bearings	~		
Brakes		•	
Performance	~		
Hand Brake	~		
Tyres (lowest observed tread	depth	of tyre	es)
Left front	10).4	mm
Right front	11.0		mm
Left rear	10.2		mm
Right rear	10.8		mm
Spare	Yes		
Suspension			
Suspension performance	~		
Steering performance	V V		
Shock absorbers	~		
Air Conditioning / Heater			
Operation	~		
Electrical / Accessories	•		
Head lights	~		
Tail lights		~	
Indicators	~		
Dashboard warning lights	VVV		
Wipers (front & rear)	~		
Window winder FL	~		
Window winder FR	~		
Window winder RL			~
Window winder RR			~
Rear view mirrors	~		
Radio (basic test only)	~		
CD (basic test only)	~		
Number of keys	2		
Central locking	~		
Remote locking			~
Sat. Nav. (basic test only)			~
Reversing camera			~
Date: 07 Aug 20	19		

ı	have read	l and	understa	and thic	condition	anide

Jason Young

Name•	