

Report ID: 18,087,433


Version:

Created: 19 Jun 2018

Make:	Nissan	Model:	Presage	Body Style:	SUV
Year:	2,004	Registration:	GDG532	Reg Expiry:	02 Jul 2018
WoF Expiry:	29 Jul 2018	Odometer:	169,726 Kms	Good No:	18087433
VIN:	7AT0DH6HX11029308 Next Service:		Service History: No		

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

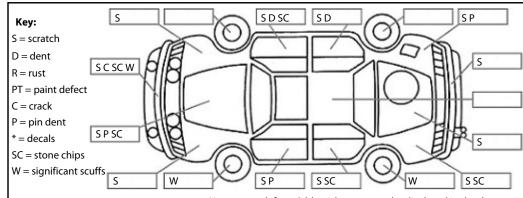

# **Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Number plate lights not going. Rear wiper missing. Marks on LH headlamp lens. LH indicator repeater lamp has moisture. LR door monsoon missing. Front bumper has damage LHS. Tray between front seats is broken. Wear on steering wheel. Trim damaged on LF seat. All seats have marks.

Conditions During Body Inspection: Dry

# **Under Carriage & Under Bonnet Inspection Comments**

Engine has oil seepage. Steering rack has oil seepage. Rear swaybar bushes are worn. RHR swaybar link is worn. LHR swaybar link is broken. Heat shield on muffler is coming apart and is not secure. LF guard liner is damaged. Dent under sill RHS.

## **Interior Comments** Average Seats Average Carpets Average **Panels** Average Dashboard

### **General Comments**

Rear shocks are worn. Drives ok.

Road Conditions During Test Drive: Dry

**Engine Timing Mechanism: Timing Chain** 

**Evidence of Cam Belt Replacement:** Kms: Not Applicable

Date: 19 Jun 2018 Inspected by: Roger King

Name: .....

	Pass	Fail	N/A
Engine			
Oil level	~		
Smoke & fumes	\( \times \)		
Performance	~		
Noise	~		
Cooling System			
Coolant condition	✓ ✓		
Performance	>		
Radiator / Hoses (visual)	~		
Transmission			
Operation	~		
Noise	>		
Clutch			~
CV joints	<b>'</b>		
Wheel bearings	>		
Brakes			
Performance	~		
Hand Brake	~		
Tyres (lowest observed tread	l depth	of tyre	es)
Left front	į	5	mm
Right front	4	1	mm
Left rear	***	3	mm
Right rear	4	1	mm
Spare		Yes	
Suspension			
Suspension performance	~		
Steering performance	~		
Shock absorbers	~		
Air Conditioning / Heater			
Operation	~		
Electrical / Accessories			
Head lights	~		
Tail lights	~		
Indicators	~		
Dashboard warning lights	~		
Wipers (front & rear)	V V V V V V V V V V V V V V V V V V V		
Window winder FL	~		
Window winder FR	~		
Window winder RL	~		
Window winder RR	<b>/</b>		
Rear view mirrors			
Radio (basic test only)	<b>/</b>		
CD (basic test only)	~		
Number of keys	1		
Central locking	<b>/</b>		
Remote locking	~		
Sat. Nav. (basic test only)			<b>'</b>
Reversing camera			

Signature: .....