


Make:	Toyota	Model:	Estima	Body Style:	People Mover
Year:	2,001	Registration:	FPW285	Reg Expiry:	05 Jul 2018
WoF Expiry:	14 Feb 2019	Odometer:	295,423 Kms	Good No:	18255459
VIN:	7AT0H61YX10035907	Next Service:	280,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

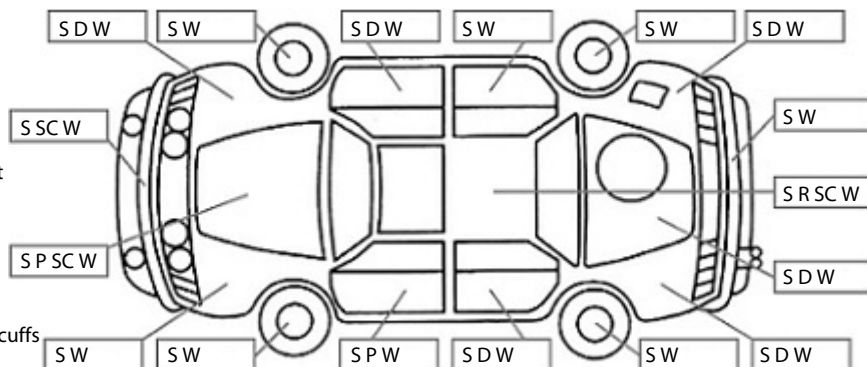

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Plastic trim on bottom of left front door has broken clips. Plastic trim missing on left rear guard by left rear wheel. Has no spare tyre. Glue stuck to top of dashboard.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Rear brake disc/rotors worn. Oil leak from right rear of engine. Oil leak from gearbox area. Steering rack weeping fluid. Power steering hoses leaking. Oil leak around rocker cover.

Interior Comments

Seats	Average
Carpets	Good
Panels	Good
Dashboard	Average

General Comments

Transmission needs a service. (dirty oil.) Engine oil has been over filled. Small burn hole in drivers seat & foam on right side of base is worn out of shape. Remote key has bent stork & will not work in ignition of door locks. One of fins broken off on vent in left side of dashboard.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 252,760

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6.2	mm	
Right front	6.4	mm	
Left rear	7.2	mm	
Right rear	6.6	mm	
Spare	No		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)			✓
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 06 Jul 2018

I have read and understood this condition guide.

Name:

Signature: