

Basic Vehicle Condition Guide

Report ID: 18,256,637


Version:

Created: 02 Jul 2018

Make: Model: **Body Style:** Sedan Nissan Maxima Year: 2,007 Registration: DYN545 **Reg Expiry:** 02 Jan 2018 **WoF Expiry: Odometer: Good No:** 16 Aug 2018 235,873 Kms 18256637 **Next Service:** VIN: **Service History:** JN1BBUJ31A0300005

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

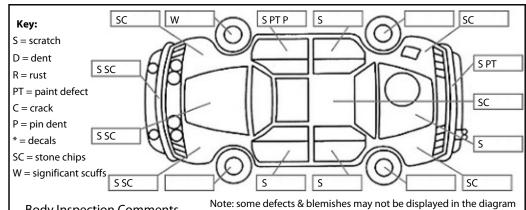

Body Inspection Comments

Paint faded on all door window frames. Clearcoat is coming off vehicle. Water and rust in spare wheel well. Loose wires in boot. RF door hinges are worn.

Screws in dash RHS. Wear on LF seatbelt. Wear on RF seat.

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Radiator overflow bottle is damaged. Coolant additive concentration below manufactures recomended level suggest coolant change. Surface rust on suspension and crossmembers. Front exhaust mount damaged.

| <u>Interior Comments</u> | | | | |
|--------------------------|---------|--|--|--|
| Seats | Average | | | |
| Carpets | Average | | | |
| Panels | Average | | | |
| Dashboard | Average | | | |

General Comments

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Kms: Not Applicable

02 Jul 2018 Inspected by: Roger King Date:

Name:

| | Dana | Fail | N/A | | |
|------------------------------|--------------|---------|----------|--|--|
| Engine | Pass | Ган | IN/A | | |
| Oil level | ./ | | | | |
| Smoke & fumes | • | | | | |
| Performance | \(\times \) | | | | |
| Noise | • | | | | |
| Cooling System | _ | | | | |
| Coolant condition | V | | | | |
| Performance | <i>V</i> | | | | |
| Radiator / Hoses (visual) | ~ | | | | |
| Transmission | | | | | |
| Operation | ~ | | | | |
| Noise | ~ | | | | |
| Clutch | | | ~ | | |
| CV joints | ~ | | | | |
| Wheel bearings | ~ | | | | |
| Brakes | | | | | |
| Performance | ~ | | | | |
| Hand Brake | ~ | | | | |
| Tyres (lowest observed tread | l depth | of tyre | es) | | |
| Left front | | 5 | mm | | |
| Right front | 6 | | mm | | |
| Left rear | 6 | | mm | | |
| Right rear | 6 | | mm | | |
| Spare | | Yes | | | |
| Suspension | | | | | |
| Suspension performance | ~ | | | | |
| Steering performance | V | | | | |
| Shock absorbers | ~ | | | | |
| Air Conditioning / Heater | | | | | |
| Operation | ~ | | | | |
| Electrical / Accessories | | | | | |
| Head lights | ~ | | | | |
| Tail lights | ~ | | | | |
| Indicators | ~ | | | | |
| Dashboard warning lights | ~ | | | | |
| Wipers (front & rear) | \(\times \) | | | | |
| Window winder FL | ~ | | | | |
| Window winder FR | ~ | | | | |
| Window winder RL | V | | | | |
| Window winder RR | ' | | | | |
| Rear view mirrors | ~ | | | | |
| Radio (basic test only) | ~ | | | | |
| CD (basic test only) | ~ | | | | |
| Number of keys | 2 | 1 | | | |
| Central locking | ~ | | | | |
| Remote locking | ~ | | | | |
| Sat. Nav. (basic test only) | | | ~ | | |
| Reversing camera | | | ' | | |

Signature: