


|                    |                |                      |             |                         |             |
|--------------------|----------------|----------------------|-------------|-------------------------|-------------|
| <b>Make:</b>       | Ford           | <b>Model:</b>        | Focus       | <b>Body Style:</b>      | Hatchback   |
| <b>Year:</b>       | 2,001          | <b>Registration:</b> | EWH75       | <b>Reg Expiry:</b>      | 31 Aug 2018 |
| <b>WoF Expiry:</b> | 18 Dec 2018    | <b>Odometer:</b>     | 183,066 Kms | <b>Good No:</b>         | 18302546    |
| <b>VIN:</b>        | WFOAXXWPD1P676 | <b>Next Service:</b> | 190434      | <b>Service History:</b> | No          |

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

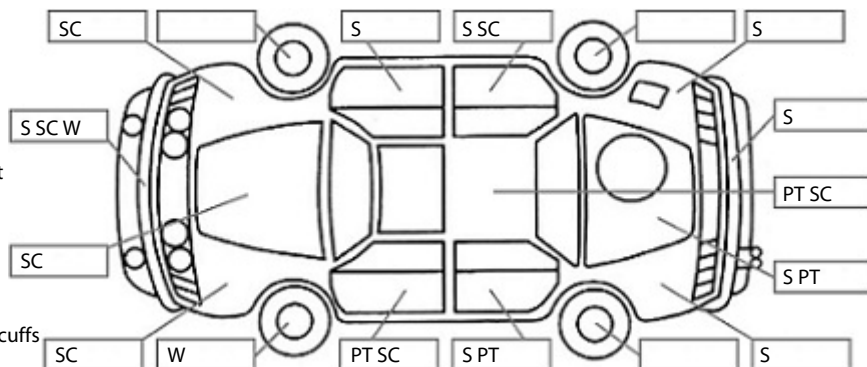

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Clearcoat is coming off vehicle. Paint missing on LH mirror.

Remote locking not working. Rust and water in spare wheel well, also spare wheel retaining bolt bracket has rusted off floor. Rust on jack and tools. Paint coming off roof and top of tailgate. Stonechips on windscreen.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufactures recommended level suggest coolant change. Brakes have wear.

## Interior Comments

|           |         |
|-----------|---------|
| Seats     | Average |
| Carpets   | Average |
| Panels    | Average |
| Dashboard | Average |

## General Comments

Excessive engine vibration. Automatic transmission has harsh changing when cold. Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 104,000

|  | Pass | Fail | N/A |
|--|------|------|-----|
| Engine                                       |      |      |     |
| Oil level                                    | ✓    |      |     |
| Smoke & fumes                                | ✓    |      |     |
| Performance                                  | ✓    |      |     |
| Noise  | ✓    |      |     |
| Cooling System                               |      |      |     |
| Coolant condition                            | ✓    |      |     |
| Performance                                  | ✓    |      |     |
| Radiator / Hoses (visual)                    | ✓    |      |     |
| Transmission                                 |      |      |     |
| Operation                                    | ✓    |      |     |
| Noise  | ✓    |      |     |
| Clutch                                       |      |      | ✓   |
| CV joints                                    | ✓    |      |     |
| Wheel bearings                               | ✓    |      |     |
| Brakes                                       |      |      |     |
| Performance                                  | ✓    |      |     |
| Hand Brake                                   | ✓    |      |     |
| Tyres (lowest observed tread depth of tyres) |      |      |     |
| Left front                                   | 5    | mm   |     |
| Right front                                  | 5    | mm   |     |
| Left rear                                    | 2    | mm   |     |
| Right rear                                   | 3    | mm   |     |
| Spare  | Yes  |      |     |
| Suspension                                   |      |      |     |
| Suspension performance                       | ✓    |      |     |
| Steering performance                         | ✓    |      |     |
| Shock absorbers                              | ✓    |      |     |
| Air Conditioning / Heater                    |      |      |     |
| Operation                                    | ✓    |      |     |
| Electrical / Accessories                     |      |      |     |
| Head lights                                  | ✓    |      |     |
| Tail lights                                  | ✓    |      |     |
| Indicators                                   | ✓    |      |     |
| Dashboard warning lights                     | ✓    |      |     |
| Wipers (front & rear)                        | ✓    |      |     |
| Window winder FL                             | ✓    |      |     |
| Window winder FR                             | ✓    |      |     |
| Window winder RL                             | ✓    |      |     |
| Window winder RR                             | ✓    |      |     |
| Rear view mirrors                            | ✓    |      |     |
| Radio (basic test only)                      | ✓    |      |     |
| CD (basic test only)                         |      |      | ✓   |
| Number of keys                               | 2    |      |     |
| Central locking                              | ✓    |      |     |
| Remote locking                               |      | ✓    |     |
| Sat. Nav. (basic test only)                  |      |      | ✓   |
| Reversing camera                             |      |      | ✓   |

Inspected by: Roger King

Date: 30 Jul 2018

I have read and understood this condition guide.

Name: .....

Signature: .....