


<b>Make:</b>	Nissan	<b>Model:</b>	Terrano	<b>Body Style:</b>	Wagon
<b>Year:</b>	1,997	<b>Registration:</b>	BKW658	<b>Reg Expiry:</b>	09 Feb 2019
<b>WoF Expiry:</b>	13 Dec 2018	<b>Odometer:</b>	161,745 Kms	<b>Good No:</b>	18303766
<b>VIN:</b>	7A8DH2B0703016570	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

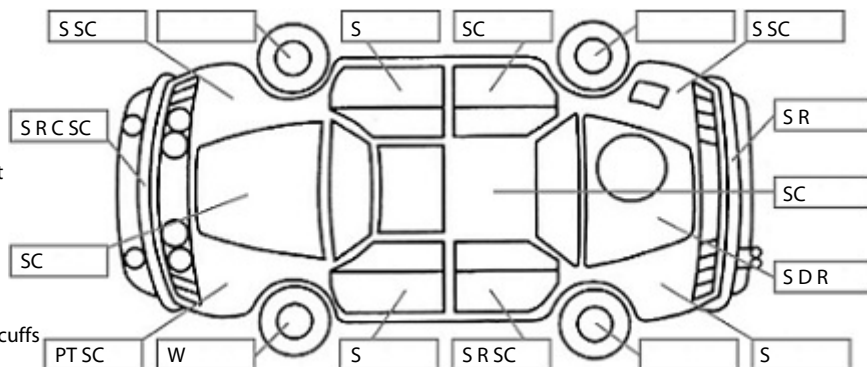

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Paint damage LF and LR flares. Clearcoat is coming off vehicle. LH sill has large dent. Running boards are very rusty. LR door has rust around Weatherstrip. Tailgate and rear bumper are rusty. Crack in RH mirror body. Stonechips on windscreen. Damage on front bumper and toe eye cover missing.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Ruat mark on LF guard inner lip. Sound deadener on bonnet coming apart. Coolant additive concentration below manufactures recommended level suggest coolant change. Both rear swaybar links and swaybar bushes are worn. Engine has oil seepage. Surface rust on front and rear ends of chassis.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Wheels have no center caps. Alarm has issues. Wear on RF seat and both front door cards. Wear on steering wheel. Remote locking not working.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	2	mm	
Right front	3	mm	
Left rear	4	mm	
Right rear	3	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 01 Aug 2018

I have read and understood this condition guide.

Name: .....

Signature: .....