


Make:	Ford	Model:	Courier	Body Style:	Utility
Year:	1,995	Registration:	TS5049	Reg Expiry:	26 Oct 2018
WoF Expiry:	20 Jan 2019	Odometer:	236,125 Kms	Good No:	18311800
VIN:	JC0AAASGHCT48190	Next Service:	240000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

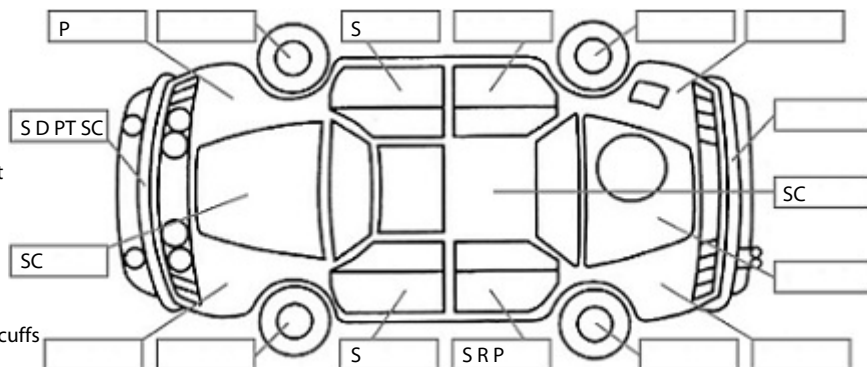

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Aerial broken. Rust in window frame on LR door, frame is not secure in door. Wooden deck in tray is worn. Paint is faded. Dent in RH C pillar. RR door outer handle not working. RF door hinges worn. Stonechips on windscreen. LF corner lamp is cracked. All door cards are damaged.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Rust on LH corner of radiator support panel and RH corner of fire wall. Engine has oil seepage. Coolant additive concentration below manufactures recommended level suggest coolant change. Rust in both front wheel arches by body mounts behind wheel. Rust in rear of LH sill.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Surface rust on front of chassis and suspension. Engine drive belt noisy.
Extra petrol tank fitted.
Both rear door ashtrays missing. RF seat is worn. Steering wheel is worn.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	8	mm	
Right front	8	mm	
Left rear	7	mm	
Right rear	7	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking			✓
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 08 Aug 2018

I have read and understood this condition guide.

Name:

Signature: