

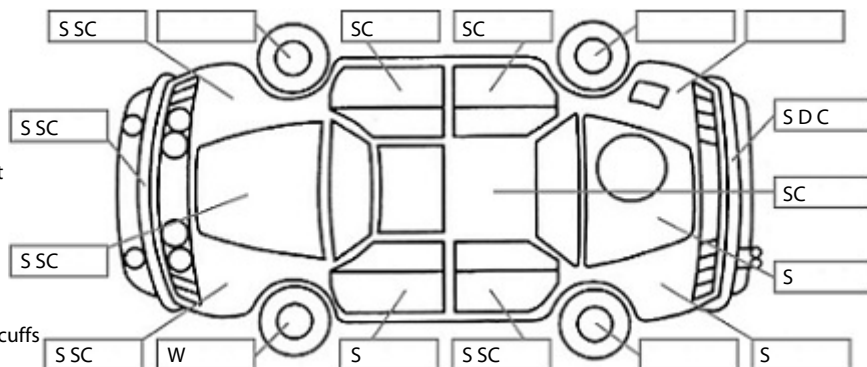
<b>Make:</b>	Mazda	<b>Model:</b>	Tribute	<b>Body Style:</b>	SUV
<b>Year:</b>	2,001	<b>Registration:</b>	FFE714	<b>Reg Expiry:</b>	04 Jul 2018
<b>WoF Expiry:</b>	24 Nov 2018	<b>Odometer:</b>	199,773 Kms	<b>Good No:</b>	18314527
<b>VIN:</b>	7AT0C136X09104558	<b>Next Service:</b>	200314	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs


**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

LF spotlight broken. Rear bumper is damaged. RH taillight broken. Corrosion on wheels. Stonechips on windscreen.  
Front sunglasses holder in roof is damaged. Wear on RF seat and steering wheel.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Exhaust leaks in flexi and rear muffler. Exhaust is rusty. Rust on both crossmembers and suspension arms. Rust in floor and around crossmember mounts. Engine has oil leaks. Front brakes need attention as brakes are not using full swept area of discs.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Engine check lamp and radiator coolant lamp are on.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance		✓	
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	1	mm	
Right front	2	mm	
Left rear	3	mm	
Right rear	4	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 07 Aug 2018

I have read and understood this condition guide.

Name: .....

Signature: .....