

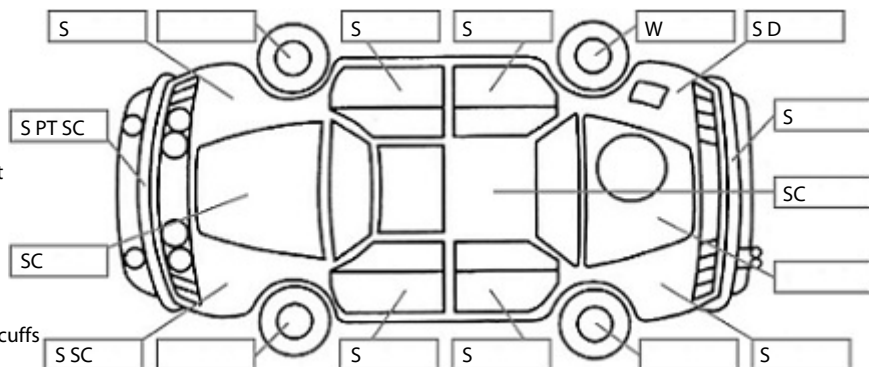
| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Toyota | Model: | Ipsium | Body Style: | Wagon |
| Year: | 1,997 | Registration: | DDW392 | Reg Expiry: | 31 Aug 2018 |
| WoF Expiry: | 25 Aug 2018 | Odometer: | 252,012 Kms | Good No: | 18315952 |
| VIN: | 7A8H6330706059106 | Next Service: | 256536 | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs


Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Moisture in RR indicator. Stonechips on windscreen.

RF seat and seatbelt are worn. Cloth coming off all door cards. Steering wheel has wear. Remote locking not working.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Cambelt has been changed but cannot read kms,so should be checked. Engine has oil seepage. Coolant additive concentration below manufactures recommended level suggest coolant change. Front brake discs are worn.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes

Kms: 1

| | Pass | Fail | N/A |
|--|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 3 | mm | |
| Right front | 3 | mm | |
| Left rear | 4 | mm | |
| Right rear | 4 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | | ✓ | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Roger King

Date: 14 Aug 2018

I have read and understood this condition guide.

Name:

Signature: