


<b>Make:</b>	Nissan	<b>Model:</b>	Primera	<b>Body Style:</b>	Sedan
<b>Year:</b>	2,000	<b>Registration:</b>	ZL1688	<b>Reg Expiry:</b>	14 Jan 2019
<b>WoF Expiry:</b>	22 Sep 2018	<b>Odometer:</b>	156,163 Kms	<b>Good No:</b>	18322261
<b>VIN:</b>	JN1BCAP11A0202632	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

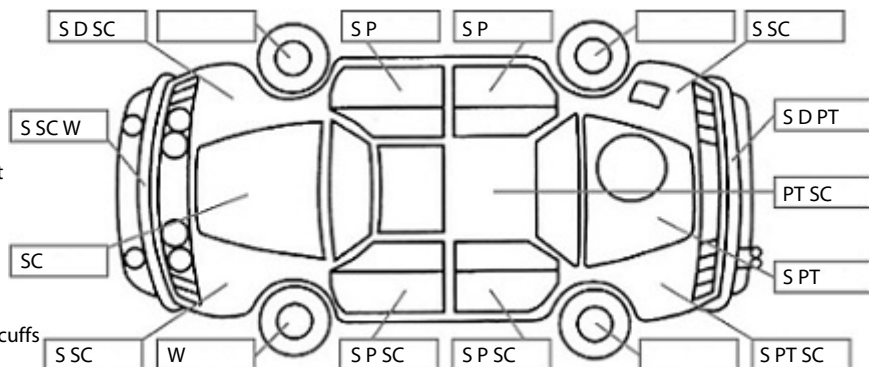

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

LF guard liner and mudflap not secure. Clearcoat is coming off vehicle. Rear bumper not fitting correctly RHS. Boot carpet, boot board and trim over boot lock are dirty or damaged. Aerial broken. RF door hinges worn. Front bumper not fitting correctly RHS. Bonnet protector worn. Marks on rear seat.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Engine has oil seepage. Edge wear on RF tire. Rattle in heat shield on exhaust.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Stonechips on windscreen. Wear in carpet and steering wheel. Marks on dash. Rust marks in spare wheel well.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	6	mm	
Right front	1.5	mm	
Left rear	2	mm	
Right rear	5	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 13 Aug 2018

I have read and understood this condition guide.

Name: .....

Signature: .....