


<b>Make:</b>	Nissan	<b>Model:</b>	Altima	<b>Body Style:</b>	Sedan
<b>Year:</b>	2015	<b>Registration:</b>	LPW261	<b>Reg Expiry:</b>	28 Sep 2018
<b>WoF Expiry:</b>		<b>Odometer:</b>	112,863 Kms	<b>Good No:</b>	18327378
<b>VIN:</b>	MNTBCAL33A000002	<b>Next Service:</b>	100,000kms	<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

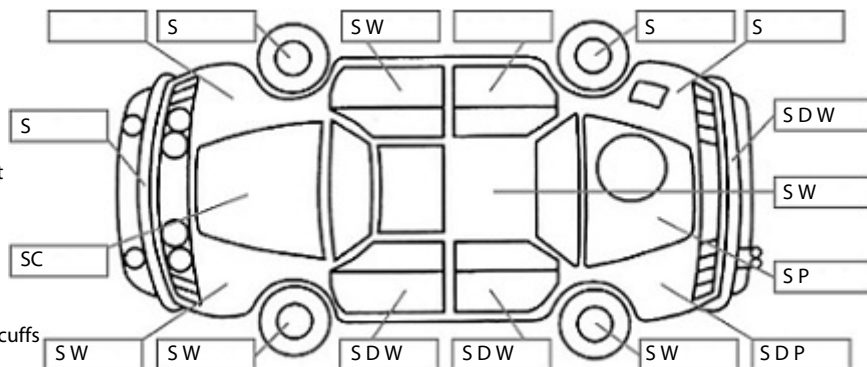

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Small stone crack in middle of windscreen. Stone chips in windscreen. Large dent in left rear door & left rear guard. Small impact damage to rear bumper. Scratches & scuffs along left side sill. Left front tyre tread depth below legal limit, needs replaced.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Clean  
Flat battery

## Interior Comments

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

## General Comments

Large dent in left rear door & left rear guard wheel arch. Wheel arch would need repaired to pass a w.o.f. Lock button not working on key remote. Battery in key remote will need replaced soon. Central lock only working from switch inside drivers door.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	0.8	mm	
Right front	5.3	mm	
Left rear	2.4	mm	
Right rear	3.4	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking		✓	
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Stuart Melbourne

Date: 24 Dec 2018

I have read and understood this condition guide.

Name: .....

Signature: .....