


<b>Make:</b>	Hyundai	<b>Model:</b>	Sonata	<b>Body Style:</b>	Sedan
<b>Year:</b>	2,008	<b>Registration:</b>	ENL687	<b>Reg Expiry:</b>	09 Dec 2018
<b>WoF Expiry:</b>	18 Aug 2019	<b>Odometer:</b>	85,377 Kms	<b>Good No:</b>	18329811
<b>VIN:</b>	KMHET41VR7A412242	<b>Next Service:</b>	89413	<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

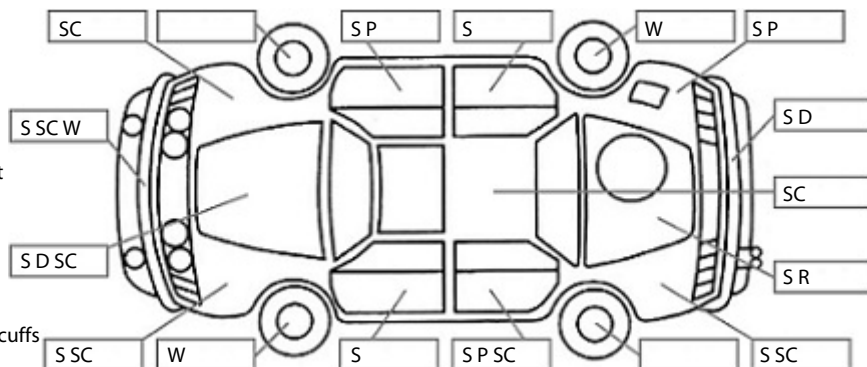

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Paint damage on LF outer door handle. Rust on LH edge of boot lid and LR guard from aerial. Damage on RH mirror body. Stonechips on windscreen. Screw holes in console. Parts missing in console and dash. Wear on steering wheel and RH door card. Wear on RF seat.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufactures recommended level suggest coolant change. Engine has oil seepage. Turbo has oil seepage. All tires have inner edge wear.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	2	mm	
Right front	2	mm	
Left rear	2	mm	
Right rear	2	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 16 Aug 2018

I have read and understood this condition guide.

Name: .....

Signature: .....