


Report ID: 18,330,567

Version: 2

29 Aug 2018 Created:

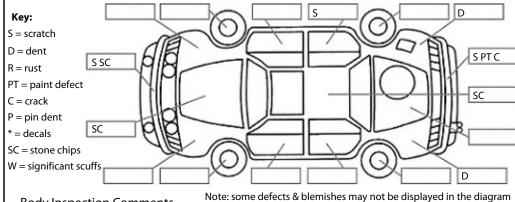

Interior Comment	<u>s</u>
Seats	Average
Carpets	Average
Panels	Average
Dashboard	Good

	Date:	29 Aug 20	18

1	lake:	Toyota	Model:	Caldina	Body Style:	Wagon		Pass	Fail	N/A
•	ear:	2,001	Registration:	: CED335 <b>Reg Expiry:</b> 01 Nov 2018			Engine			
V	oF Expiry:	28 Feb 2019	Odometer:	241,260 Kms	Good No:	18330567	Oil level	<		
1	IN:	7A8H6240704053998	Next Service:		Service Histor	<b>y:</b> No	Smoke & fumes	~		
	lata. This was						Performance	~		
		<b>port is not a warranty</b> a guide only. Conside	eration is made	for age and mileage.	Parts have not	been dismantled or	Noise	~		
b	liagnostic tes	sting undertaken. The	vehicle has been	driven up to 50km/h	from cold. The	Vendor recommends	Cooling System			
1	Tuli mechan	ical inspection prior to	purchase and tr	ils can be arranged to	r an additional (	.narge.	Coolant condition	~		
				S	705	D	Performance	~		
	(ey:		$=$ $\langle 0 \rangle$		Z(Q)_		Radiator / Hoses (visual)	~		
	= scratch = dent	NE				<b>AD</b>	Transmission			
	= uent = rust	s sc	·		7	SPTC	Operation	V		
	– ταστ Γ = paint defe	ect NP					Noise	~		
	= crack					SC	Clutch			~
	= pin dent	110					CV joints	~		
	= decals	c 6/6					Wheel bearings	~		
	C = stone chip	/	$\mathcal{L}(\Omega)$		200		Brakes			
V	/ = significant	scuffs				D	Performance	V		
	Pody Inch	action Comments	Note: som	ne defects & blemishes	may not be disp	layed in the diagram	Hand Brake	~		
	Tailgate har	pection Comments					Tyres (lowest observed tread	d depth	of tyre	! es)
	rangate nai	idle blokell					Left front	· :	3	mm
							Right front	3		mm
							Left rear	2		mm
_	Condition	ns During Body Ins	nection:	Dry			Right rear		<u>-</u> 3	mm
_	Condition	is builing body iris	Dection.	Dry			Spare		Yes	
	Under Ca	rriage & Under Bor	net Inspectio	on Comments			Suspension		103	
	Dirty						Suspension performance	~		
							Steering performance	~		
							Shock absorbers	~		
							Air Conditioning / Heater			
							Operation	<b>/</b>		
	Interior C	<u>omments</u>					Electrical / Accessories			
I	Seats	Average					Head lights	<b>/</b>		
	Jeans						Tail lights	~		
	Carpets	Average					Indicators	~		
	Panels	Average					Dashboard warning lights	~		
	1 011613						Wipers (front & rear)	~		
	Dashboa	rd Good					Window winder FL	~		
-							Window winder FR	~		
	General C	Comments					Window winder RL	~		
							Window winder RR	~		
							Rear view mirrors	~		
							Radio (basic test only)	+	<b>V</b>	
							CD (basic test only)		<i>V</i>	
							Number of keys	1	•	
	D 1.C	100 D	D.:	_			Central locking	1		
	Road Con	ditions During Test	Drive:	Dry				-		
	Engine Tir	ming Mechanism:	Cambelt	 t			Remote locking	~		
	-	of Cam Belt Replac		es .	Kms: 13	31,339	Sat. Nav. (basic test only)			<b>V</b>
_						, , , , , , , , , , , , , , , , , , , ,	Reversing camera			~
	Inspected	d by: Stuart Melbourr	ne				Date: 29 Aug 20	18		
-										

I have read and understood this condition guide.

Signature: .....