


<b>Make:</b>	Toyota	<b>Model:</b>	Estima	<b>Body Style:</b>	People Mover
<b>Year:</b>	2,000	<b>Registration:</b>	DSG800	<b>Reg Expiry:</b>	21 Sep 2018
<b>WoF Expiry:</b>	23 Feb 2019	<b>Odometer:</b>	325,236 Kms	<b>Good No:</b>	18333433
<b>VIN:</b>	7A8H61Y0706012978	<b>Next Service:</b>	325800	<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

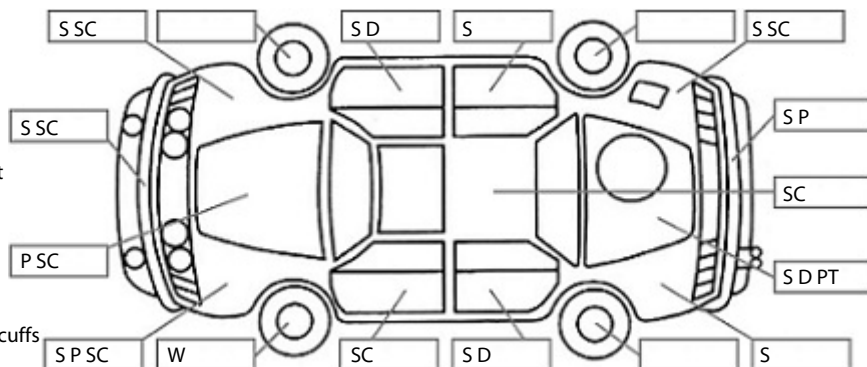

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Moisture in LR indicator. Both RH wheels missing center caps. All window track rubbers on doors are damaged. LH sliding door difficult to open. Carpet in cargo area has marks. No jack or tools. Headlamp lenses need buffing.  
LF inner door handle worn. RF seat and seatbelt are worn. AC not cold.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Bonnet stay grommet missing. Engine has oil seepage. Cambelt needs checking. RH radiator mount missing. Coolant additive concentration below manufactures recommended level suggest coolant change.all brake pads low. Fuel line has been repaired, now has a section of hose in it.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Both sills have damage on seam . RF door has damage underneath. Baffle in rear muffler is loose. Clearcoat is coming off vehicle.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes

Kms: 96,413

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4	mm	
Right front	4	mm	
Left rear	5	mm	
Right rear	5	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 20 Aug 2018

I have read and understood this condition guide.

Name: .....

Signature: .....