

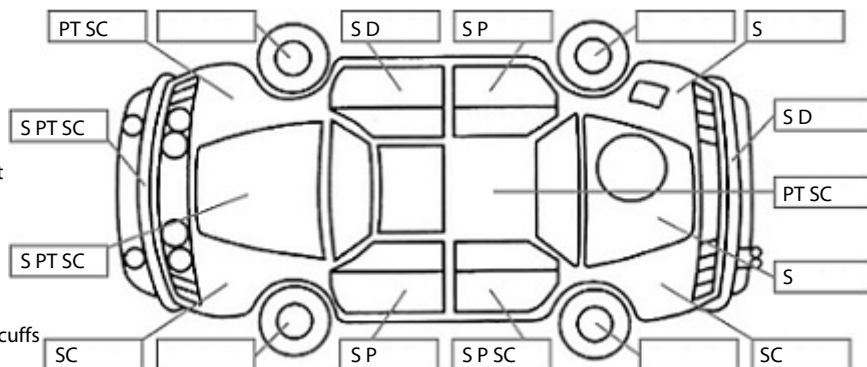
<b>Make:</b>	Honda	<b>Model:</b>	CRV	<b>Body Style:</b>	Wagon
<b>Year:</b>	1,996	<b>Registration:</b>	BCM157	<b>Reg Expiry:</b>	20 Oct 2018
<b>WoF Expiry:</b>	27 Aug 2018	<b>Odometer:</b>	292,858 Kms	<b>Good No:</b>	18342161
<b>VIN:</b>	7A88G7H0703099572	<b>Next Service:</b>		<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs


**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Moisture on RH taillight. Clearcoat is coming off vehicle. Rust under LR door tread plate. Wiper scratch on rear windscreen. No jack or tools. Paint coming off wheel rims. Old seatbelt catch wired to car, RF. Marks on roof lining. Wear on RF seat. Bonnet release cable damaged.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Cambelt has been changed but cannot read kms,so should be checked. Engine has oil seepage. LR swaybar link is worn. Steering rack has oil seepage.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Stonechips on windscreen. RF door hinges are worn. Central locking not working on LF door. Engine drive belt noisy at startup.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 1

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	1.8	mm	
Right front	1.5	mm	
Left rear	2	mm	
Right rear	4	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking		✓	
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 27 Aug 2018

I have read and understood this condition guide.

Name: .....

Signature: .....