

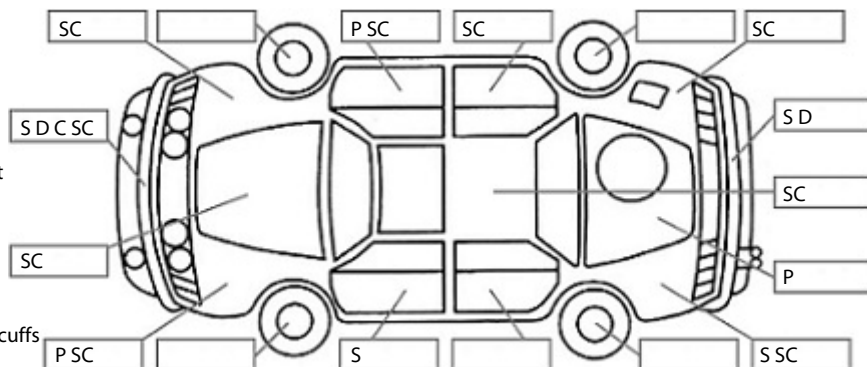
<b>Make:</b>	Ford	<b>Model:</b>	Territory	<b>Body Style:</b>	SUV
<b>Year:</b>	2006	<b>Registration:</b>	DNA35	<b>Reg Expiry:</b>	21 Jan 2019
<b>WoF Expiry:</b>	09 Jan 2019	<b>Odometer:</b>	166,284 Kms	<b>Good No:</b>	18500688
<b>VIN:</b>	6FPAAJGAT6P30186	<b>Next Service:</b>	176180	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs


**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Trim broken on bottom of RF door. LH trim on top of sill broken at front and has rust marks on body on both sides. Tailgate guides on body are rusty. Front bumper damaged and spotlights missing. RH indicator repeater has moisture. Lid on dash not shutting. Panel beside gear selector is damaged.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Rust on seams of both front inner guards and below brake booster. Surface rust under floor and bad around LR corner by towbar. Engine and transmission have oil seepage. All brake pads very low. Both rear suspension bump stops are worn.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Battery is low.  
Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6	mm	
Right front	6	mm	
Left rear	3	mm	
Right rear	4	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 24 Sep 2018

I have read and understood this condition guide.

Name: .....

Signature: .....