


<b>Make:</b>	Ford	<b>Model:</b>	Falcon	<b>Body Style:</b>	Wagon
<b>Year:</b>	2003	<b>Registration:</b>	LNA869	<b>Reg Expiry:</b>	28 Oct 2018
<b>WoF Expiry:</b>	16 Oct 2018	<b>Odometer:</b>	243,391 Kms	<b>Good No:</b>	18564465
<b>VIN:</b>	6FPAAAJGWA3S9327	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

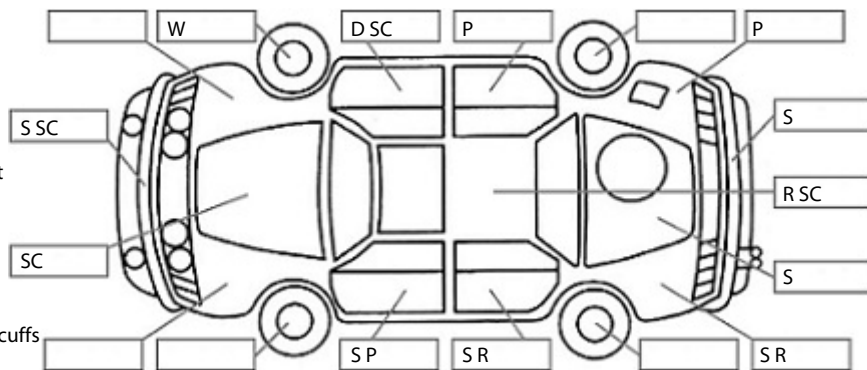

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Rust on all door window frames. Rust LH dogleg. LH taillight has cracks. Rust in roof above RH cargo glass. Stonechips on windscreen and delaminating across top edge. Headlamps need buffing. Roof lining coming off, held with drawing pins. Both console lids are damaged.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Rust RH inner guard. Engine has oil seepage. Rust under RF edge of bonnet. Bonnet gas struts not holding. Rust on upper radiator mounts. Coolant additive concentration below manufactures recommended level suggest coolant change. Surface rust under floor. Power steering hose weeping.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

All seats and RF seatbelt have wear. Both front door cards have wear. Rear wiper arm loose. Remote locking not working on tailgate. Inside mirror damaged.

Rear diff vent hose broken.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5	mm	
Right front	5	mm	
Left rear	5	mm	
Right rear	5	mm	
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 24 Sep 2018

I have read and understood this condition guide.

Name: .....

Signature: .....